

KWETHLUK (KWT)(PFKW) 1 SSW UTC-9(-8DT) N60°47.42' W161°26.62'

MC GRATH

25 B NOTAM FILE KWT

L-3C

RWY 18-36: 3199X75 (GRVL) MIRL

IAP

RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 27'. Brush.

RWY 36: REIL. PAPI(P4L)—GA 3.2° TCH 28'. Brush.

SERVICE: LGT ACTIVATE MIRL Rwy 18-36, PAPI and REIL Rwy 18 and Rwy 36 and rotating bcn—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Numerous arpts in the vicinity. Rwy 18-36 lgts partially obscured by brush and grass. Rwy 18-36 ruts at rwy ends. Rwy 18-36 heaves, ruts and erosion channels along rwy sfc. Weeds in front of both PAPI indicators. Windsock may be unreliable.

AIRPORT MANAGER: (907) 543-2498

WEATHER DATA SOURCES: AWOS-3P 120.000 (907) 868-7313. (WX CAM)

COMMUNICATIONS: CTAF 122.9


ANCHORAGE CENTER APP/DEP CON 125.2

RADIO AIDS TO NAVIGATION: NOTAM FILE BET.

BETHEL (H) VORTACW 114.1 BET Chan 88 N60°47.09'

W161°49.46' 074° 11.2 NM to fld. 105/14E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

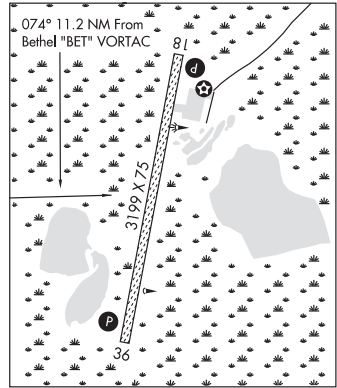

KWIGILLINGOK (GGV)(PAGG) 0 S UTC-9(-8DT) N59°52.54' W163°10.08'

BETHEL

21 NOTAM FILE ENA

RWY 15-33: 1835X40 (GRVL-DIRT)

RWY 15: Brush.

RWY 33: Brush.

AIRPORT REMARKS: Unattended. Night ops prohibited, exc rotary wing acft. Rwy cond not monitored, recommend visual inspection prior to using. Safety areas narrow and uneven, undulates. Waterfowl invof arpt. Multiple wind turbine twrs east of arpt. Windsock unreliable. Segmented circle deteriorated, unusable. Rwy 15-33 NSTD markings, rwys marked with cones and markers. Portable rwy lgts avbl for emergency use only. Ctc village police safety officer. Rwy 15-33 pot holes and dips on rwy and ramp, rwy used as road.

AIRPORT MANAGER: (907) 543-2498

COMMUNICATIONS: CTAF 122.7

ANCHORAGE CENTER APP/DEP CON 125.2

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

