

NAKEEN (76Z) 0 NE UTC-9(-8DT) N58°55.66' W157°02.83'
 50 NOTAM FILE ENA
RWY 04-22: 800X30 (DIRT)

KODIAK

RWY 04: Trees.
RWY 22: Tree.

AIRPORT REMARKS: Unattended. Rwy has 10° dogleg, actual heading 04-21. Smokestack NE. Recommended ldg Rwy 04, tkf Rwy 21. Soft sand on Rwy 22 end. Rwy 04-22 not maintained, recommend visual inspection prior to use. Moose, bear and waterfowl invof rwy. Rwy 04-22 sfc soft and undulating, overgrown with brush and grass. 10' sand and grvl hill parallel to southeast runway edge, south winds may cause turbulent and gusty conditions. Rwy 04-22 sfc soft and muddy when wet, 24" grass growing on rwy sfc with 24" dips and humps on southeast half of rwy vicinity thld Rwy 22. Town of Nakeen burned down and abandoned.


COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE AKN.

KING SALMON (H) (H) VORTAC 112.8 AKN Chan 75 N58°43.48' W156°45.14' 307° 15.3 NM to fld. 95/16E.

TACAN antenna offset 150' se
 TACAN AZIMUTH unusable:
 130°-140° byd 13 NM blo 4,000'
 130°-140° byd 30 NM
 332°-348° byd 19 NM blo 5,000'
 DME unusable:
 332°-348° byd 19 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: For a toll-free call to Kenai FSS dial 1-888-864-1737.

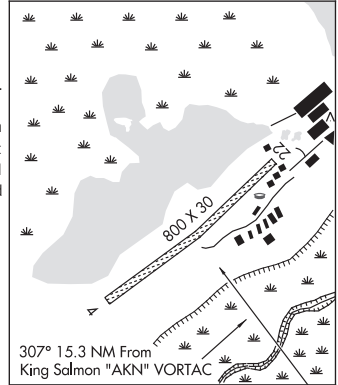

NAKNEK

NAKNEK (5NK) 1 N UTC-9(-8DT) N58°44.08' W157°01.51'
 70 NOTAM FILE ENA

KODIAK

RWY 08-26: 1950X50 (GRVL)
RWY 08: Brush.
RWY 26: Brush.
RWY 14-32: 1836X45 (GRVL) 3.0% up SE
RWY 14: Brush.
RWY 32: Brush.

SERVICE: S3 FUEL 100LL LGT Airport unlit.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Windsock unreliable. Acft on east side of Rwy 14-32 tied down in safety area. Road parallel to and 45' east of Rwy 32 centerline. Uncontrolled vehicular tfc on rwys. No line of sight between rwys or waterways. Float acft departing northwest lake to East, cross arpt at low alt. Acft not visible until airborne. Rwy 08-26 rocks exceeding 2" diameter and ruts 6". Rwy 08 slopes downhill to east. Rwy 14-32 rocks exceeding 2"-3" in diameter and 3" ruts. First 200' Rwy 32 soft when wet. First 400' Rwy 32 slopes downhill.

AIRPORT MANAGER: 907-246-3325


COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE AKN.

KING SALMON (H) (H) VORTAC 112.8 AKN Chan 75 N58°43.48' W156°45.14' 258° 8.6 NM to fld. 95/16E.

TACAN antenna offset 150' se
 TACAN AZIMUTH unusable:
 130°-140° byd 13 NM blo 4,000'
 130°-140° byd 30 NM
 332°-348° byd 19 NM blo 5,000'
 DME unusable:
 332°-348° byd 19 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: For a toll-free call to Kenai FSS dial 1-888-864-1737.

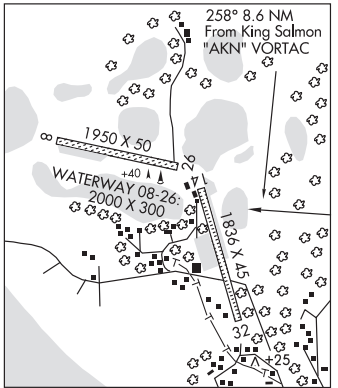

WATERWAY 08W-26W: 2000X300 (WATER)

SEAPLANE REMARKS: Unattended. E apch to lake over Rwy 14-32 Naknek arpt and Tibbetts arpt. Ramp. No line of sight between rwys or waterways. Rwy 08W-26W not on arpt property and is not owned or opr by the state of Alaska.