

MOUNTAIN VILLAGE (MOU)(PAMO) 2 NE UTC-9(-8DT) N62°05.69' W163°40.97'
339 B NOTAM FILE MOU

BETHEL
L-3C
IAP

RWY 02-20: 3501X75 (GRVL-DIRT) MIRL 1.2% up N

RWY 02: REIL. PAPI(P4L)—GA 3.0° TCH 25'.

RWY 20: REIL. PAPI(P4L)—GA 3.0° TCH 25'.

SERVICE: LGT ACTIVATE MIRL Rwy 02-20, PAPI and REIL Rwy 02 and Rwy 20 and rotating bcn—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to landing. Rwy is under construction. Only the east side is usable. There is a 48' high mound of rocks the length of the rwy immediately to the west side of the rwy and a 15' drop off immediately to the east side of the rwy. The rwy sfc has some rocks greater than 3' in diameter. Due to construction, most of the lighting along the sides of the rwy is either damaged or missing. Dip in Rwy 2 near PAPI.

AIRPORT MANAGER: 907-438-2416

WEATHER DATA SOURCES: AWOS-3P 118.35 (907) 591-2511. (WX CAM)

COMMUNICATIONS: CTAF 122.9

ST. MARY'S RCO 122.35 (KENAI FSS)


ANCHORAGE CENTER APP/DEP CON 124.0

RADIO AIDS TO NAVIGATION: NOTAM FILE KSM.

ST MARYS NDB (HW) 230 SMA N62°03.56'

W163°16.91' 269° 11.5 NM to fld. 343/12E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

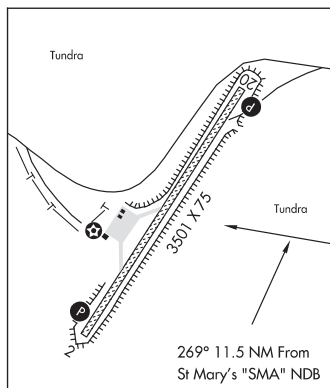

MURPHY DOME N64°56.97' W148°21.15'
RCO —122.3 (FAIRBANKS FSS)

FAIRBANKS
L-3A, 3D, 4J

MURPHYS PULLOUT SPB (See KETCHIKAN on page 147)

NABESNA N62°56.96' W141°54.59' NOTAM FILE ORT.
NDB (HW) 390 AES at Northway. 1715/20E.

ANCHORAGE
H-1B, L-1A, 3E

NAKED ISLAND RCO N60°38.78' W147°20.72'
RCO —133.15 (JUNEAU FSS)

ANCHORAGE
L-3A, 3D, 4G

NAKEEN (76Z) 0 NE UTC-9(-8DT) N58°55.66' W157°02.83'
50 NOTAM FILE ENA

KODIAK

RWY 04-22: 800X30 (DIRT)

RWY 04: Trees.

RWY 22: Tree.

AIRPORT REMARKS: Unattended. Rwy has 10° dogleg, actual heading 04-21. Smokestack NE. Recommended ldg Rwy 04, tkf Rwy 21. Soft sand on Rwy 22 end. Rwy 04-22 not maintained, recommend visual inspection prior to use. Moose, bear and waterfowl inofw rwy. Rwy 04-22 sfc soft and undulating, overgrown with brush and grass. 10' sand and grvl hill parallel to southeast runway edge, south winds may cause turbulent and gusty conditions. Rwy 04-22 sfc soft and muddy when wet, 24" grass growing on rwy sfc with 24" dips and humps on southeast half of rwy vicinity thld Rwy 22. Town of Nakeen burned down and abandoned.

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE AKN.

KING SALMON (H) VORTACW 112.8 AKN Chan 75 N58°43.48'

W156°45.14' 307° 15.3 NM to fld. 95/16E.

TACAN antenna offset 150' se

TACAN AZIMUTH unusable:

130°-140° byd 13 NM blo 4,000'

130°-140° byd 30 NM

332°-348° byd 19 NM blo 5,000'

DME unusable:

332°-348° byd 19 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: For a toll-free call to Kenai FSS dial 1-888-864-1737.

