

**PORT WALTER SPB** (PWR)(PPWR) 0 N UTC-9(-8DT) N56°22.86' W134°39.06'

JUNEAU

00 NOTAM FILE SIT

**WATERWAY NE-SW:** 3000X400 (WATER)

**SEAPLANE REMARKS:** Unattended. Year round ops. Bay freezes over in winter occasionally. Bay exposed to northerly swells at high tides. Rocks near shore in NE channel. Float low in water at Little Port Walter.

**AIRPORT MANAGER:** 907-723-4457

**COMMUNICATIONS:** CTAF 122.9

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SIT.

**BIORKA ISLAND (H) VORTACW** 113.8 BKA Chan 85 N56°51.56' W135°33.08' 114° 41.4 NM to fld. 260/20E.

VORTAC unusable:

230°-235° byd 15 NM blo 5,000'


300°-320° byd 27 NM blo 9,000'

360°-080° byd 25 NM blo 12,000'

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Sitka FSS dial

1-800-478-6300. For a toll free call to Juneau FSS dial

1-800-WX-BRIEF.

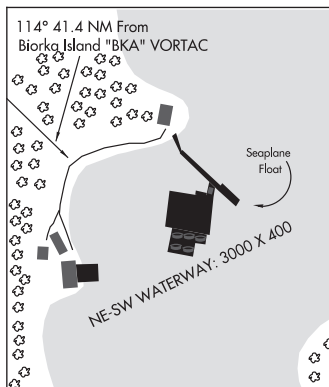

**PORT WILLIAMS SPB** (KPR) 0 S UTC-9(-8DT) N58°29.41' W152°34.93'

KODIAK

00 NOTAM FILE ADQ

**WATERWAY E-W:** 10000X4000 (WATER)

**AIRPORT REMARKS:** Unattended. Operating area in Port William Sound. Heavy swells dur South and West winds. Planes heel up on beach next to former cannery. Beach contains rocks over 12" in diameter, can disappear dur high tides. Water low invof Idg area.

**AIRPORT MANAGER:** 907-688-7623

**COMMUNICATIONS:** CTAF 122.8

**RADIO AIDS TO NAVIGATION:** NOTAM FILE ADQ.

**WOODY ISLAND NDB (HW)** 394 RWO N57°46.49' W152°19.48' 335° 43.8 NM to fld. 24/14E.

**PORTAGE CREEK** (A14)(PAOC) 0 E UTC-9(-8DT) N58°54.39' W157°42.67'

KODIAK

129 NOTAM FILE DLG

**RWY 10-28:** 1920X60 (GRVL-DIRT) 1.5% up E

**RWY 10:** Brush.

**RWY 28:** Brush.

**RWY 01-19:** 1470X60 (GRVL-DIRT) 1.4% up N

**RWY 01:** Trees.

**RWY 19:** Brush.

**AIRPORT REMARKS:** Unattended. Rwy condition not monitored, recommend visual inspection prior to using; no maint on arpt. Rwy 01-19 sfc ruts 4" to 6" deep, 300' from thld Rwy 01 where acft turn around for tkf.

Rwy 10-28 very soft with deep loose grvl. First 200' of Rwy 28

CLOSED with brush growing on edges. Brush and trees encroaching on

all rwy sfc. Rws very soft, deep ruts may develop when sfc wet. Rwy

01-19 marked with reflective orange cones. Rwy 10 marked with

reflective orange cones. Slopes up to E end 1.5%. No line of sight btn

rwy ends. Rwy 10 and Rwy 01 safety areas soft, may be unusable.

Rwy 28 safety area eroding near bluff.

**AIRPORT MANAGER:** 907-842-5511

**COMMUNICATIONS:** CTAF 122.9


**KEMUK MOUNTAIN RCO** 122.55 (DILLINGHAM RADIO) Opr

1645-0845Z±, other times ctc Kenai FSS.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DLG.

**DILLINGHAM (H) VOR/DME** 116.4 DLG Chan 111 N58°59.65' W158°33.13' 086° 26.7 NM to fld. 81/15E.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.

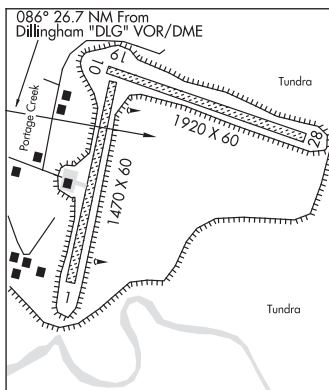

**PORTAGE GLACIER - PORTAGE VISITOR CENTER** POR N60°47.07' W148°50.47'

ANCHORAGE

ASOS 135.45 (907) 783-2626 Test ASOS elev 103 ft msl.

L-1A, 3D, 4G