

TATALINA LRRS (TLJ)(PATL) AF 7 S UTC-9(-8DT) N62°53.69' W155°58.68'

933 NOTAM FILE PATL Not insp.

RWY 17-35: 3820X150 (GRVL) 1.1% up N**RWY 17:** REIL. PAPI(P2R)—GA 5.0° TCH 52'. Hill.**RWY 35:** REIL. PAPI(P2L)—GA 3.0° TCH 40'.**SERVICE:** **MILITARY**—LGT PAPI Rwy 17 baffled and unusable byd 5° right of centerline.

MILITARY REMARKS: Attended Mon-Fri 1700-0200Z, CLOSED weekends and holidays. All mil, govt and civ acft opr shall obtain a PPR ctl number a min of 1 hr prior to dep for site, req no earlier than day of planned travel, ctc site personnel at: DSN 317-552-1106/1040, C907-552-1106/1040. Pax must coord all travel with ARS Program Mgmt (DSN 317-552-4400/9630 or C907-552-4400/9630) prior to any non-emergency travel to site. USAF installation, all civil acft oprs rqr civil acft ldg permits prior to ldg at facility. Fines will be levied against violators and reports will be forwarded to FAA FSDOS IAW 32CFR855 and USAF Operating Instructions. Oprs must have on board a copy of current permit. Contact 11 AF Airfield Mgr for permits 907-552-1448/4176. Civil Aircraft Landing Permit (CALP) ctc numbers DSN: 317-552-1448/4176 or COM: (907)552-1448/4176, e-mail: aklandingpermits@elmendorf.af.mil. AFI 10-1001 is lctd at:

<http://www.e-publishing.af.mil/shared/media/epubs/AFI10-1001.pdf>. Mail CALP application to: Attn: 11 AF Airfield Manager 10471 20th Street Suite 231 Elmendorf AFD AK 99506. CAUTION: Rwy not level laterally, West side higher than East side. CAUTION: Turbulence both approaches. After initial ctc on 126.2 or 121.5 expect a 30 min delay for current airstrip conditions. Rwy 17 and Rwy 35 marked with 2' by 3' square orange markers.

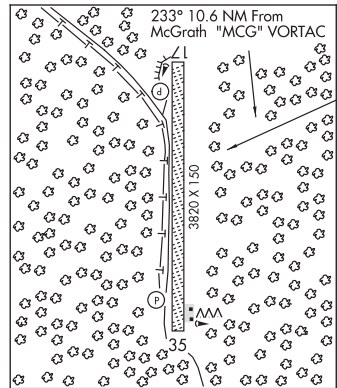
AIRPORT MANAGER: 907-552-4400**WEATHER DATA SOURCES:** AWOS-3 (907) 552-1106 (WX CAM)**COMMUNICATIONS:** CTAF 126.2

RCO 122.3 (KENAI RADIO)

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.**MC GRATH**

L-3C

DIAP

**TATITLEK** (7KA)(PAKA) 0 NW UTC-9(-8DT) N60°52.34' W146°41.47'

62 B NOTAM FILE JNU

RWY 13-31: 3701X75 (GRVL) MIRL 0.6% up NW**RWY 13:** Brush.**RWY 31:** Brush.**SERVICE:** LGT Actvt MIRL Rwy 13-31—CTAF.

AIRPORT REMARKS: Unattended. Rwy cond not mntd; rcmd visual insp prior to lndg. High trrn NW-SE. Rwy 31 sfc slopes up. Rwy 13 thr 45 ft hydr. Rwy 13-31, safety area 150 by 4300 ft; all sides rough with pot holes and lrg rocks. Segmented circles overgrown.

AIRPORT MANAGER: 907-835-5658**COMMUNICATIONS:** CTAF 122.7

VALDEZ RCO 122.2 (JUNEAU RADIO)

ANCHORAGE CENTER APP/DEP CON 119.3

RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.**JOHNSTONE POINT (H) VOR/DME** 116.7 JOH Chan 114

N60°28.86' W146°35.96' 335° 23.7 NM to fld. 48/18E.

wx cam

VOR unusable:

090°-124° byd 23 NM blo 8,000'

125°-188° byd 10 NM

DME unusable:

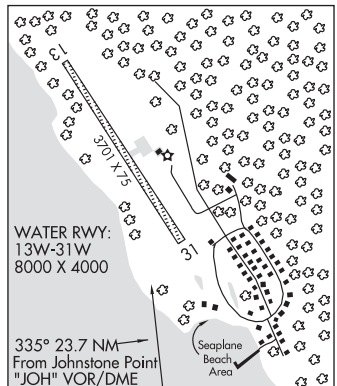
090°-124° byd 23 NM blo 12,000'

125°-191° byd 10 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.**ANCHORAGE**

L-1A, 3D, 4G

IAP

**WATERWAY 13W-31W:** 8000X4000 (WATER)**SEAPLANE REMARKS:** Unattended. Waterway condition not monitored, recommend visual inspection prior to using. Be alert: rocks in water area low tide.