

ANAKTUVUK PASS (AKP)(PAKP) 0 SE UTC-9(-8DT) N68°08.02' W151°44.60'

2106 B NOTAM FILE AKP

RWY 02-20: 4800X100 (GRVL) MIRL 1.1% up NE

RWY 02: REIL. PAPI(P2L)—GA 3.0° TCH 41'. Brush.

RWY 20: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Brush.

SERVICE: LGT ACTIVATE MIRL Rwy 02-20, REIL and PAPI Rwys 02 and 20, and rotating bcn—CTAF.

AIRPORT REMARKS: Attended continuously. Rwy 02-20 Be Alert: rwy located in mountain valley. High terrain in all quadrants causing turbulent winds. Rwy 02-20 recommend visual inspection prior to use. Cold temperature restricted airport. Altitude correction required at or below -31C.

AIRPORT MANAGER: (907) 852-0489

WEATHER DATA SOURCES: AWOS-3P 135.75 (907) 661-3020. (WX CAM)

COMMUNICATIONS: CTAF/UNICOM 122.8

ANAKTUVUK PASS RCO 122.15 (FAIRBANKS RADIO)

ANCHORAGE CENTER APP/DEP CON 124.6 352.0

RADIO AIDS TO NAVIGATION: NOTAM FILE AKP.

NDB (MHW) 348 AKP N68°08.20' W151°44.65' at fld. 2087/21E.

NDB unusable:

166°-181° byd 12 NM

186°-236° byd 21 NM blo 11,000'


286°-326° byd 20 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1-866-248-6516.

POINT BARROW

H-1A, L-41

IAP

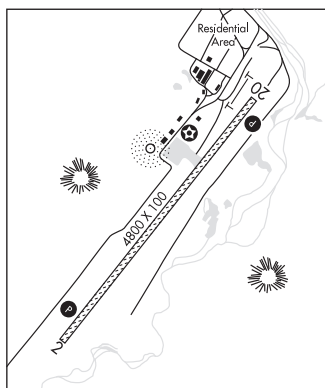

ANCHOR POINT

ANCHOR RIVER AIRPARK (AKØØ) PVT 1 NW UTC-9(-8DT) N59°46.98' W151°51.18'

KODIAK

120 TPA—920(800) NOTAM FILE Not insp.

RWY 16-34: 2500X75 (GRVL)

RWY 16: Trees. Rgt tfc.

RWY 34: Trees.

AIRPORT REMARKS: Unattended. Rwy conditions unmonitored, visual inspection recommended prior to use. 100' trees surround rwy. Rwy not maintained in winter. Arpt restricted to daylight VFR operations only. Tfc pattern alt 800' AGL. Rising terrain N of rwy.

AIRPORT MANAGER: (907) 399-1053


COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE HOM.

HOMER (H) VOR/DME 114.6 HOM Chan 93 N59°42.57'

W151°27.40' 275° 12.8 NM to fld. 1626/15E.

COMM/NAV/WEATHER REMARKS: Local call to Homer FSS dial 235-8588. For a toll free call to Kenai FSS dial 1-866-864-1737.

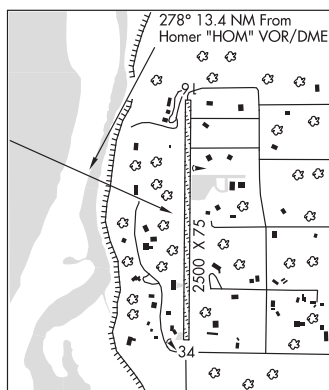

ANCHOR RIVER AIRPARK (See ANCHOR POINT on page 40)

ANCHORAGE

ALASKA RGNL HOSPITAL HELIPORT (20K) 2 E UTC-9(-8DT) N61°12.76' W149°49.60'

ANCHORAGE

137 B NOTAM FILE ENA

HELIPAD H1: H175X175 (ASPH) PERIMETER LGTS

SERVICE: FUEL 100LL, JET A LGT No perimeter lgts avbl. ACTIVATE perimeter lgts—130.45.

HELIPORT REMARKS: Special Air Traffic Rules-Part 93, see Regulatory Notices. Attended Mon-Fri 1630-0200Z±. All inbound medevac acft ctc Alaska Regional Medevac on 130.45 or telephone 907-258-3822 or 800-478-9111 15 minutes prior to arrival. Extensive training in immediate vicinity of helipad may require time to secure area. Recommend approach from W through NE. Rwy H1 building in close proximity E through SW, 8' fence W side of landing area. Heliport located on Merrill Fld. Lgt poles 85' to southeast and 110' to north east.

AIRPORT MANAGER: 907-343-6305

COMMUNICATIONS: CTAF 126.0 UNICOM 122.95

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.