
TIOGA MUNI (D6Ø) 2 SE UTC–6(–5DT) N48°22.82′ W102°53.84′ **BILLINGS**
2271 B NOTAM FILE GFK **H–2H, L–13E, 14F**
RWY 12–30: H5102X75 (ASPH) S–25 MIRL 0.6% up SE **IAP**
RWY 12: PAPI(P2L)—GA 3.0° TCH 26′.
RWY 30: PAPI(P2L)—GA 3.0° TCH 25′. Road.
RWY 03–21: 3200X120 (TURF) 0.6% up SW
SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** Rwy 12–30 MIRL preset low ints, to increase ints ACTVT PAPI Rwy 12 and Rwy 30—CTAF. ACTVT bcn—CTAF.
AIRPORT REMARKS: Attended 1300–2300Z‡. Fuel self svc 24 hr credit card access, full svc per attendant sked and on call aft hrs. Confirm snow removal with arpt manager or FBO after major storm. Birds and deer on and invof arpt. Mechanic avbl on call contact FBO at 701–664–3012. Rwy 03 twy and apron marked with reflectors.
AIRPORT MANAGER: 701-216-0036
WEATHER DATA SOURCES: AWOS–3 118.575 (701) 664–4490.
COMMUNICATIONS: CTAF 122.9
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 127.6
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.
RADIO AIDS TO NAVIGATION: NOTAM FILE ISN.
WILLISTON (VL) (DH) VORW/DME 116.3 ISN Chan 110
N48°15.20′ W103°45.04′ 069° 35.0 NM to fld. 2365/8E.

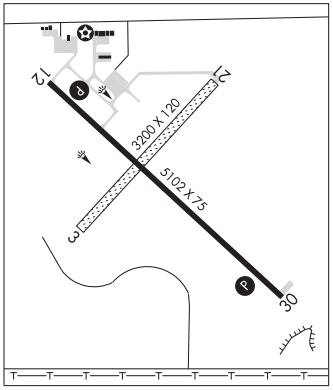

TOMLINSON FLD (See NEW ROCKFORD on page 351)

TOWNER MUNI (D61) 1 NE UTC–6(–5DT) N48°21.57′ W100°23.73′ **TWIN CITIES**
1484 B NOTAM FILE GFK
RWY 03–21: 2810X120 (TURF) 0.3% up NE
RWY 03: Road.
RWY 16–34: 2732X150 (TURF) LIRL
RWY 16: Road.
RWY 34: Road.
SERVICE: **LGT** Dusk–Dawn. ACTVT LIRL Rwy 16–34—CTAF.
AIRPORT REMARKS: Unattended. Confirm winter conditions after snowstorm with arpt manager 701–537–5137 or 701–537–3519. Rwy 03 has 140′ water tower 2000′ from thld 600′ left of extended centerline. 3′ ditch southeast end Rwy 16–34 and southwest end Rwy 03–21. Rwy 03–21 has 5 ft rwy vis sight clnc violation. Rwy 03–21 mkd 3 ft wooden red mkrs on ends and intxn. Rwy 16–34 mkd 3 ft wooden red mkrs on ends and intxn.
AIRPORT MANAGER: 701-537-3519
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.
HELIPAD H1: H30X30 (CONC)

TRULSON FLD (See PLAZA on page 354)

TURTLE LAKE MUNI (91N) 1 SW UTC–6(–5DT) N47°30.58′ W100°55.00′ **TWIN CITIES**
1916 NOTAM FILE GFK
RWY 08–26: 3148X120 (TURF) LIRL 0.5% up E
SERVICE: **LGT** ACTVT LIRL Rwy 08–26—CTAF. LIRL Rwy 08–26 out of service indefinitely.
AIRPORT REMARKS: Unattended. Confirm winter conditions with arpt manager before use due to irregular snow removal, call 701–220–0707. Deer and wildlife on and invof of arpt. Rwy 08–26 sfc grass soft when wet. Rwy 08 has 10′ dropoff 50′ out from thld.
AIRPORT MANAGER: (701) 516-3826
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.