BIDDEFORD MUNI (B19) 2 S UTC–5(–4DT) N43°27.85′ W70°28.34′ **NEW YORK**
157 B TPA—995(838) NOTAM FILE BGR **L–32H**
RWY 06–24: H3000X75 (ASPH) S–25 MIRL 0.3% up NE **IAP**
RWY 06: REIL. PAPI(P4L)—GA 3.5° TCH 31′. Brush.
RWY 24: Brush.
SERVICE: **FUEL** 100LL **LGT** Actvt REIL Rwy 06; PAPI Rwy 06; MIRL Rwy 06–24—CTAF.
NOISE: Noise abatement ctc AMGR for dtls.
AIRPORT REMARKS: Attended Mon–Thur 1500–2100Z‡, Sat–Sun 1400–2100Z‡. Deer and turkeys on and invof arpt. Ultralight and prcht act on and invof arpt. 24 hr fuel w/major credit card–self svc. Rwy 24 calm wind rwy.
AIRPORT MANAGER: 207-282-1579
COMMUNICATIONS: **CTAF/UNICOM** 123.0
Ⓡ **PORTLAND APP/DEP CON** 119.75 (1045–0500Z‡)
Ⓡ **BOSTON CENTER APP/DEP CON** 128.2 (0500–1045Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Portland Apch at 207-874-7320, when Apch clsd ctc Boston ARTCC at 603-879-6859.
RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.
KENNEBUNK (VH) (DH) VORW/DME 117.1 ENE Chan 118
N43°25.54′ W70°36.81′ 086° 6.6 NM to fld. 192/17W.
DME unusable:
030°–184° byd 25 NM blo 2,000′
185°–230° byd 25 NM blo 2,500′
268°–278° byd 30 NM blo 4,600′
VOR unusable:
017°–040° byd 40 NM
130°–133° byd 40 NM
192°–202° byd 40 NM blo 2,500′
192°–202° byd 48 NM blo 5,000′
192°–202° byd 69 NM
203°–294° byd 40 NM
295°–305° byd 40 NM blo 5,000′
295°–305° byd 52 NM
306°–359° byd 40 NM

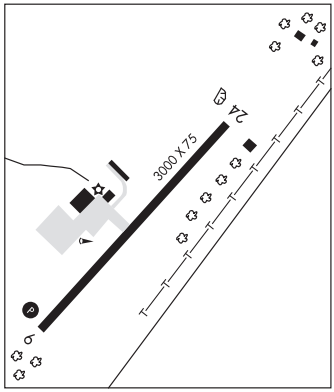

BOWDOINHAM

MERRYMEETING FLD (Ø8B) 1 SE UTC–5(–4DT) N44°00.00′ W69°53.23′ **MONTREAL**
61 NOTAM FILE BGR
RWY 14–32: 1935X100 (TURF)
RWY 14: Thld dsplcd 425′. Trees.
RWY 32: Thld dsplcd 143′. Trees.
AIRPORT REMARKS: Attended irregularly. Call for rwy conditions prior to ldg. Wildlife on or invof arpt. Winter ops (Nov 1–May 1) skis only, rwy not plowed. Rwy 14 has +15′ roadway 95′ rgt and +15′ building 125′ left at thld. No line of sight between rwy ends.
AIRPORT MANAGER: 781-864-7011
COMMUNICATIONS: **CTAF** 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Portland Apch at 207-874-7320, when Apch clsd ctc Boston ARTCC at 603-879-6859.

BOWMAN FLD (See LIVERMORE FALLS on page 74)

BRADFORD CAMPS SPB (See ASHLAND on page 56)

BREWER (ØB2) 2 S UTC–5(–4DT) N44°45.83′ W68°46.07′ **HALIFAX**
125 TPA—725(600) NOTAM FILE BGR
RWY 01–19: 1730X30 (TURF) 0.3% up N
RWY 01: Brush. Rgt tfc.
RWY 19: Trees.
SERVICE: S2
AIRPORT REMARKS: Unattended. +25 ft power line 460ft N of Rwy 19 end. Rwy 01–19 +35 ft trees and brush 30 ft to 125 ft from centerline along east side. Rwy 19 +25 ft house 80 ft from thr, 50 ft right of cntrln. Wildlife on or invof arpt. Public golf course at EOR 01. During winter ski only ops. Make all apch/deps to east of arpt. Rwy 01–19 cntr 50 ft mowed.
AIRPORT MANAGER: 207-299-4086
COMMUNICATIONS: **CTAF** 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Bangor Apch at 207-561-2500 extn 1.