

GRAYLING (KGX)(PAGX) 1 S UTC-9(-8DT) N62°53.53' W160°03.98'

138 B NOTAM FILE ENA

RWY 17-35: 4000X75 (GRVL) MIRL 1.1% up S

RWY 17: Brush.

RWY 35: Brush. Rgt tfc.

SERVICE: LGT ACTIVATE MIRL Rwy 17-35—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to landing. Cold temperature airport. Altitude correction required at or below -23C. Wind sock and segmented circle and overgrown with brush and may be unreliable.

AIRPORT MANAGER: (907) 438-2416

COMMUNICATIONS: CTAF 122.9

ANVIK RCO 122.4 (KENAI RADIO)

Ⓡ **ANCHORAGE CENTER APP/DEP CON** 118.15

RADIO AIDS TO NAVIGATION: NOTAM FILE UNK.

UNALAKLEET (VH) (H) VOR/DME 116.9 UNK Chan 116

N63°53.52' W160°41.06' 149° 62.4 NM to fld. 436/15E.

VOR unusable:

026°-041° byd 40 NM

042°-048° byd 40 NM blo 6,000'

042°-048° byd 57 NM


064°-089° byd 40 NM

090°-100° byd 51 NM blo 8,000'

101°-169° byd 40 NM

170°-173° byd 40 NM blo 11,000'

294°-020° byd 40 NM

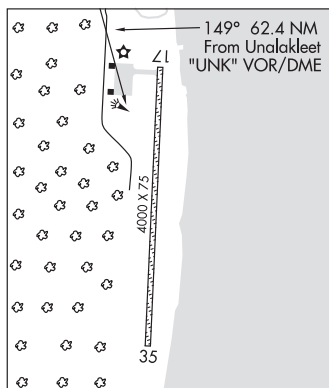

GREEN'S STRIP (See WASILLA on page 276)

GREG'N SAGE (See NORTH POLE on page 199)

GROUSE RIDGE (See PALMER on page 207)

GULKANA (GKN)(PAGK) 4 NE UTC-9(-8DT) N62°09.26' W145°27.32'

1586 B NOTAM FILE GKN

RWY 15L-33R: H5001X100 (ASPH) MIRL

RWY 15L: VASI(V4L)—GA 3.0° TCH 49'. Trees.

RWY 33R: VASI(V4R)—GA 3.0° TCH 29'. Trees.

RWY 15R-33L: 2300X60 (GRVL)

RWY 15R: Tower.

RWY 33L: Trees.

SERVICE: S2 FUEL 100LL, JET A LGT ACTVT VASI Rwy 15L and Rwy 33R; MIRL Rwy 15L-33R—CTAF.

AIRPORT REMARKS: Attended Jun-Sep Mon-Fri 1800-0200Z, Oct-May Mon-Fri 1900-0000Z. Fuel avbl 24 hours with credit card or call 907-822-4331. Migratory birds on and in vcnty of arpt dur spring. Rwy conds unmnt, rcmd visual bfr lndg. Rwy 15R-33L obst and bcn twr N apch end. Ski strip durg winter, otr times grvl strip.

AIRPORT MANAGER: 907-822-3222

WEATHER DATA SOURCES: ASOS 134.85 (907) 205-4569. (WX CAM)

COMMUNICATIONS: CTAF 122.9

RCO 122.2 (KENAI RADIO)


ANCHORAGE CENTER APP/DEP CON 119.5

SUAIS 125.3 126.3 (1-800-758-8723).

ANCHORAGE

H-1B, L-1A, 3E

IAP

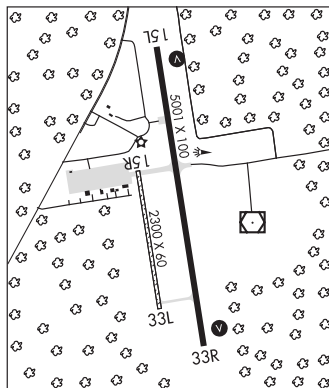

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS E svc 1500-0630Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE GKN.

(VH) (H) VORW/DME 115.6 GKN Chan 103 N62°09.23' W145°26.84' at fld. 1549/17E.

VOR unusable:

041°-051° byd 40 NM blo 11,000'
 041°-051° byd 55 NM
 052°-176° byd 40 NM
 177°-187° byd 40 NM blo 10,000'
 177°-187° byd 53 NM
 188°-224° byd 40 NM
 245°-246° byd 40 NM blo 7,000'
 245°-246° byd 67 NM
 247°-324° byd 40 NM
 342°-344° byd 40 NM blo 7,000'
 342°-344° byd 55 NM blo 13,000'
 342°-344° byd 63 NM
 359°-040° byd 40 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

GUNNUK MOUNTAIN N56°58.87' W133°48.35'
 RCO 122.175 (SITKA RADIO)

JUNEAU
 L-1C

GUSTAVUS (GST)(PAGS) 0 NE UTC-9(-8DT) N58°25.52' W135°42.45'

JUNEAU
 H-1C, L-1B
 IAP

36 B ARFF Index—See Remarks NOTAM FILE GST

RWY 11-29: H6720X150 (ASPH-GRVD) S-60,

D-100 PCR 280 F/B/X/T MIRL

RWY 11: REIL. VASI(V4R)—GA 3.0° TCH 35'.

RWY 29: REIL. VASI(V4L)—GA 3.0° TCH 39'.

RWY 02-20: H3010X60 (ASPH) S-40 PCR 237 F/B/X/T

RWY 02: Trees.


RWY 20: Trees.

SERVICE: FUEL JET A LGT ACTIVATE REIL Rwy 11 and 29; VASI Rwy 11 and 29; MIRL Rwy 11-29—CTAF.

AIRPORT REMARKS: Attended 15 May-1 Sep Fri-Mon 1830-0300Z†, 15 May-1 Sep Tue-Thu 1500-0300Z†, 1 Sep-15 May 1500-2330Z†. Paja on rwy, twy or prkg apron not authorized. Wildlife on & invof rwy. Fuel: cfm avbl—907-209-0305. 24 hr PPR for cargo ops ovr 100,000 lbs—amgr. Class I, ARFF Index B. ARFF svc avbl durg sked ACR ops. Clsd to ACR ops more than 30 pax seats exc PPR in writing—Rgnl Dir DOT & Pub Fac SE Rgn 6860 Glacier Highway, Juneau, AK 99801-7999. Rwy 02-20 mntnd winter months; rcmd daylight ops. 9 ft fence 554 ft S. Ltd arpt maint svc avbl: 1 Sep-14 May 1500-2330Z†; 15 May-1 Sep Fri-Mon 1900-0330Z†, Tue-Thu 1500-0330Z†. Tsnt prkg E side of Rwy 02-20; asph sfc soft; acft ovr 12,500 lbs ctc amgr 24 hr prior Mon-Fri 1500-2330Z†. Tsnt prkg avbl GA ramp aces via Twy F. Arpt sand lrg gradation than FAA rcmd/see AC150/5200-30. Cold temperature airport. Altitude correction required at or below -13C. Be Alert: See General Notices—Enroute CTAF freqs.

AIRPORT MANAGER: 907-697-2251

WEATHER DATA SOURCES: AWOS-3P 125.9 (907) 697-2447. (WX CAM)

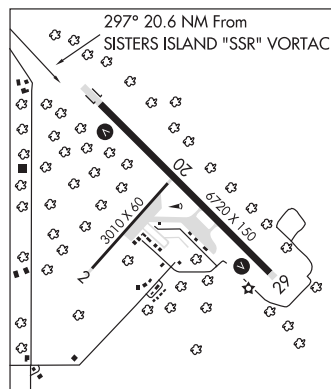

CONTINUED ON NEXT PAGE