

NAPAKIAK (WNA)(PANA) 0 W UTC–9(–8DT) N60°41.42′ W161°58.71′ **BETHEL**
17 B NOTAM FILE WNA **L–3C**
RWY 16–34: 3248X60 (GRVL) MIRL **IAP**
RWY 16: REIL. PAPI(P4L)—GA 3.0° TCH 26′. Brush.
RWY 34: REIL. PAPI(P4L)—GA 3.0° TCH 25′. Brush.
SERVICE: **LGT** ACTVT rotg bcn—CTAF. ACTVT REIL Rwy 16 & Rwy 34; PAPI Rwy 16 & Rwy 34; MIRL Rwy 16–34—CTAF. Rwy 16–34 rwy lgts obsc by brush.
AIRPORT REMARKS: Unattended. Rwy cond not mnt; rcmd visual insp prior to use. Nmrs arpts invof Napakiak. Windsock unrelbl. Rwy 16–34 sfc ruts each end. 6 in dips S 1500 ft. Deep sfc ruts S side of ramp. Rough spots in parking area. Rwy 16 mkgs: lgts, cones & thr panels. Rwy 34 mkgs: lgts, cones & thr panels.
AIRPORT MANAGER: (907) 543-2498
WEATHER DATA SOURCES: AWOS–3P 121.425 (907) 868–7317. (WX CAM)
COMMUNICATIONS: CTAF 122.9
Ⓡ **ANCHORAGE CENTER APP/DEP CON** 125.2
RADIO AIDS TO NAVIGATION: NOTAM FILE BET.
BETHEL (VH) (H) VORTACW 114.1 BET Chan 88 N60°47.09′ W161°49.46′ 205° 7.3 NM to fld. 105/14E.
COMM/NAV/WEATHER REMARKS: For a toll–free call to Kenai FSS dial 1–866–864–1737.

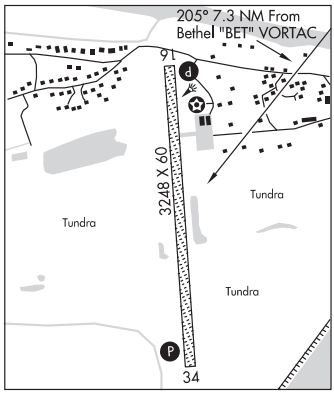

NAPASKIAK (PKA)(PAPK) 1 SW UTC–9(–8DT) N60°42.17′ W161°46.70′ **BETHEL**
11 B NOTAM FILE ENA **L–3C**
RWY 02–20: 3000X60 (GRVL) MIRL **IAP**
RWY 02: Brush.
RWY 20: Brush.
SERVICE: **LGT** ACTVT MIRL Rwy 02–20—CTAF.
AIRPORT REMARKS: Unattended. Rwy 02–20 floods in spring. Rwy cond not mnt; rcmd visual inspn prior to use. Ctn: area in front of village unusbl for float plane. Soft muddy beach. Boats and nets in river. Barges N end of rwy; machinery and supply obstns in area. Windsocks unrelbl.
AIRPORT MANAGER: (907) 543-2498
COMMUNICATIONS: CTAF 122.9
Ⓡ **ANCHORAGE CENTER APP/DEP CON** 125.2
RADIO AIDS TO NAVIGATION: NOTAM FILE BET.
BETHEL (VH) (H) VORTACW 114.1 BET Chan 88 N60°47.09′ W161°49.46′ 151° 5.1 NM to fld. 105/14E.
COMM/NAV/WEATHER REMARKS: For a toll–free call to Kenai FSS dial 1–866–864–1737.

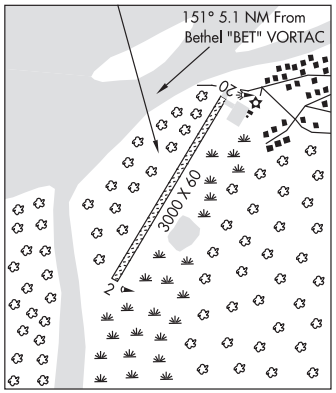

NAUKATI BAY SPB (See TUXEKAN ISLAND on page 266)