WARREN "BUD" WOODS PALMER MUNI (PAQ)(PAAQ) 1 SE UTC–9(–8DT) N61°35.70´ W149°05.32´ **ANCHORAGE**
H–1B, 2K, L–1A, 3D, 4G
IAP
249 B NOTAM FILE PAQ
RWY 16–34: H6006X100 (ASPH) S–180 PCN 18 F/B/Y/U MIRL 0.5% up N
RWY 16: REIL. PAPI(P4L)—GA 3.0° TCH 43´. Thld dsplcd 503´. Trees.
RWY 34: REIL. PAPI(P4L)—GA 3.0° TCH 52´. Hill.
RWY 10–28: H3616X75 (ASPH) PCN 2 F/B/Z/U MIRL
RWY 10: PAPI(P2L)—GA 3.0° TCH 27´. Trees.
RWY 28: PAPI(P2L)—GA 3.0° TCH 26´. Trees.
RWY 16S–34S: 1560X60 (GRVL) 0.5% up N
RUNWAY DECLARED DISTANCE INFORMATION
RWY 16: TORA–6008 TODA–6008 ASDA–6008 LDA–5508
RWY 34: TORA–6008 TODA–6008 ASDA–6008 LDA–6008
SERVICE: S4 **FUEL** 100LL, JET A1, B **LGT** When FSS clsd ACTIVATE REIL Rwy 16 and Rwy 34, PAPI Rwy 10, Rwy 28, Rwy 16 and Rwy 34; MIRL Rwy 16–34 and Rwy 10–28—CTAF. Rwy 28 PAPI does not provide obstruction clearance byd 3 NM; PAPI unusable byd 3 NM. Rwy 34 PAPI does not provide obstruction clearance byd 5.4 NM; PAPI unusable byd 5.4 NM.

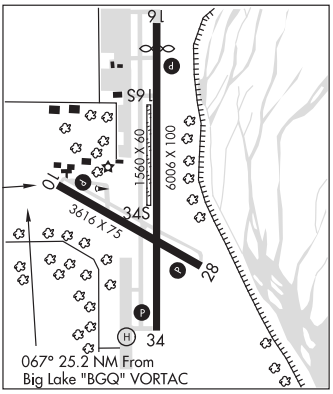

AIRPORT REMARKS: Attended 1700–0200Z‡ Mon–Fri. Rwy condition reported by 10am Mon–Fri. Rwy condition reporting not done during weekends or holidays. Rwy 10–28 CLOSED to acft over 12,500 lbs. Fuel avbl credit card 24 hrs north and south ramp. Rwy 16S–34S 1560´ by 60´ grvl ldg area avbl west side and parallel to Rwy 16–34, no simultaneous parallel ops allowed, sequence on CTAF. Thlds and edges marked with cones. 7´ fence 435´ W of Rwy 10 apch thld. Winter maintenance not avbl. Flocks of seagulls and ravens on arpt. Migratory waterfowl on arpt Spring and Fall. Be Alert—Glider act on and invof arpt Apr thru Sep. Parachute Jumping. Be alert—sky diving act invof arpt, April thru Sep. Transient parking North ramp, labeled spaces T1–T9 adjacent FSS, transient parking for large aircraft, South ramp labeled spaces T10, T11, and T12. Banner towing OPS occur May to Oct, Thurs through Sunday. Fire fighting tanker base located north end of arpt. Extensive activity with flights of multiple large acft, May–September. Use designated run–up areas and give way to emerg response acft. Contact FSS 907–745–2495, 122.4 for additional info.
AIRPORT MANAGER: 907-761-1334
WEATHER DATA SOURCES: ASOS 134.75 (907) 746–6675. (WX CAM)
COMMUNICATIONS: CTAF 123.6
FSS PAQ (PALMER) 1700–0300Z‡ OT ctc Kenai FSS.
PALMER RADIO 122.4 123.6 (LAA 123.6)
RCO 122.4 123.6 (KENAI RADIO)
Ⓡ **ANCHORAGE APP/DEP CON** 118.6 290.5
RADIO AIDS TO NAVIGATION: NOTAM FILE ENA.
BIG LAKE (H) VORTACW 112.5 BGQ Chan 72 N61°34.17´ W149°58.03´ 067° 25.2 NM to fld. 180/19E.
TACAN AZIMUTH & DME unusable:
226°–246° byd 36 NM blo 7,500´
COMM/NAV/WEATHER REMARKS: For a local call to Palmer FSS dial 745–2495.

HELIPAD H1: H50X50 (ASPH)

WASILLA CREEK AIRPARK (Ø5AK) PVT 5 NW UTC–9(–8DT) N61°40.12´ W149°11.24´ **ANCHORAGE**
620 NOTAM FILE Not insp.
RWY 01–19: 2000X75 (TURF–GRVL)
RWY 01: Trees.
RWY 19: Trees.
AIRPORT REMARKS: Unattended.
AIRPORT MANAGER: 907-841-4072
COMMUNICATIONS: CTAF 122.8
COMM/NAV/WEATHER REMARKS: LC to Palmer FSS dial 745–2495. For a toll free call to Kenai FSS dial 1–866–864–1737.