
NINILCHIK (NIN) 3 SE UTC–9(–8DT) N60°01.21′ W151°35.37′ **MC GRATH**
276 NOTAM FILE HOM
RWY 10–28: 2400X60 (GRVL)
RWY 10: Road.
RWY 28: Trees.
AIRPORT REMARKS: Unattended. State maintained on irregular basis. Rwy condition not monitored. Recommend visual inspection prior to use. Ultralight activity invof arpt. Rwy 10 edges not marked. Safety areas at both rwy ends soft.
AIRPORT MANAGER: 907-262-1187
COMMUNICATIONS: CTAF 122.9
RADIO AIDS TO NAVIGATION: NOTAM FILE HOM.
HOMER (VH) (H) VORW/DME 114.6 HOM Chan 93 N59°42.57′ W151°27.40′ 333° 19.1 NM to fld. 1626/15E.
VOR unusable:
016°–018° byd 40 NM blo 5,000′
016°–018° byd 58 NM
019°–023° byd 40 NM
033°–049° byd 40 NM
050°–060° byd 40 NM blo 12,000′
050°–060° byd 63 NM
061°–073° byd 40 NM
074°–084° byd 40 NM blo 9,500′
085°–158° byd 40 NM
169°–170° byd 40 NM blo 9,000′
171°–179° byd 40 NM blo 7,100′
171°–179° byd 54 NM blo 18,000′
276°–277° byd 40 NM
COMM/NAV/WEATHER REMARKS: For a long distance call to Homer FSS dial 907–235–8588. For a toll free call to Kenai FSS dial 1–866–864–1737.



NIXON FORK MINE (See MC GRATH on page 180)

NOATAK (WTK)(PAWN) 1 SW UTC–9(–8DT) N67°33.67′ W162°58.83′ **NOME**
92 B NOTAM FILE WTK **H–1A, L–4H**
RWY 01–19: 3992X60 (GRVL) MIRL **IAP**
RWY 01: PAPI(P4L)—GA 3.0° TCH 30′.
RWY 19: Brush.
SERVICE: **LGT** ACTVT PAPI Rwy 01; MIRL 01–19—CTAF. Rwy 01 PAPI unusbl byd 5 degs left of cntrln.
AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to landing.
AIRPORT MANAGER: 907-442-3147
WEATHER DATA SOURCES: AWOS–3P 135.75 (907) 485–2203. (WX CAM)
COMMUNICATIONS: CTAF/UNICOM 122.8
NOATAK RCO 122.4 (KOTZEBUE RADIO)
ANCHORAGE CENTER APP/DEP CON 119.2 263.0
RADIO AIDS TO NAVIGATION: NOTAM FILE WTK.
NDB/DME (MHW) 414 OQK Chan 39 N67°34.21′ W162°58.36′ at fld. 85/11E.
COMM/NAV/WEATHER REMARKS: For LC to Kotzebue FSS dial 907–442–3310. For a toll free call to Kotzebue FSS dial 1–800–478–7460. For a toll free call to Fairbanks FSS dial 1–866–248–6516.

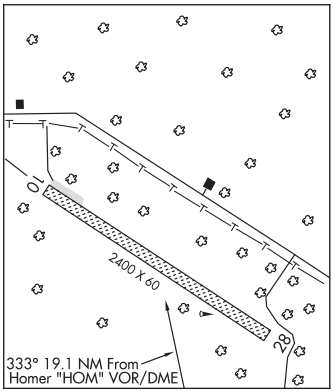