
PALMER

ABI (AK46) PVT 2 N UTC–9(–8DT) N61°37.73′ W149°02.59′ **ANCHORAGE**
750 NOTAM FILE Not insp.
RWY 07–25: 1000X40 (GRVL)
RWY 25: P–line.
AIRPORT REMARKS: Attended continuously. Rwy 25 road xs 750 ft fm thr.
AIRPORT MANAGER: 907-745-3124
COMMUNICATIONS: CTAF 123.6
COMM/NAV/WEATHER REMARKS: For a local call to Palmer FSS dial 745–2495. For a toll free call to Kenai FSS dial 1–866–864–1737.

BUTTE MUNI (AK1) 5 SE UTC–9(–8DT) N61°31.82′ W149°01.06′ **ANCHORAGE**
64 NOTAM FILE ENA
RWY 07–25: 1806X50 (GRVL–DIRT)
RWY 07: Trees.
RWY 25: Tree.
AIRPORT REMARKS: Unattended. Road alg N and S side of rwy. Rwy 07–25 safety area clr 1800′ X 200′. Rwy 07 end, 400′ safety area. Rwy 07–25 dips and 3" rocks. Nstd windsock, yellow, unrelbl. Rwy cond unmnt, visual inspn recmdd bfr lndg.
AIRPORT MANAGER: 907-745-4557
COMMUNICATIONS: CTAF 123.6
RADIO AIDS TO NAVIGATION: NOTAM FILE ENA.
BIG LAKE (VH) (H) VORTACW 112.5 BGQ Chan 72 N61°34.17′ W149°58.03′ 076° 27.4 NM to fld. 179/19E.
TACAN AZIMUTH unusable:
230°–245° byd 38 blo 8,000′
DME unusable:
230°–245° byd 38 blo 8,000′
VOR unusable:
001°–049° byd 40 NM
085°–097° byd 40 NM
098°–108° byd 40 NM blo 10,000′
098°–108° byd 48 NM
109°–155° byd 40 NM
305°–310° byd 40 NM
335°–340° byd 40 NM
352°–360° byd 40 NM blo 10,000′
352°–360° byd 49 NM

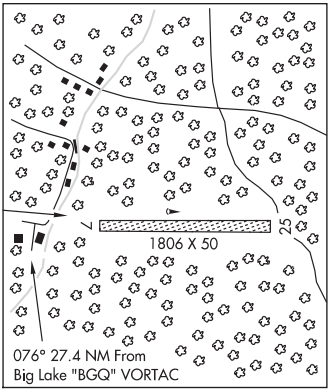

COMM/NAV/WEATHER REMARKS: For a local call to Palmer FSS dial 745–2495. For a toll free call to Kenai FSS dial 1–866–864–1737.
