TOKSOOK BAY (OOK)(PAOO) 1 NE UTC–9(–8DT) N60°32.48′ W165°05.23′ **BETHEL**
72 B NOTAM FILE OOK **L–3B**
RWY 16–34: 3218X60 (GRVL–DIRT) MIRL 0.7% up N **IAP**
RWY 16: REIL. PAPI(P4L)—GA 4.0° TCH 37′.
RWY 34: REIL. PAPI(P4R)—GA 3.0° TCH 30′.
SERVICE: **LGT** ACTVT REIL Rwy 16 and Rwy 34; PAPI Rwy 16 and Rwy 34; MIRL Rwy 16–34, and rotating bcn—CTAF. Rwy 16 PAPI unusbl byd 9° left of cntrln.
AIRPORT REMARKS: Unattended. Be Alert: Rwy condition not monitored, recommend visual inspection prior to using. Arpt subject to random and turbulent winds. Freq vehicle and ATV tfc on ramp and rwy. Rwy 16–34 NSTD markings, rwy marked with reflective cones and lgts.
AIRPORT MANAGER: (907) 543-2498
WEATHER DATA SOURCES: AWOS–3P 119.275 (907) 427–7004. (WX CAM)
COMMUNICATIONS: CTAF 122.9
KIPNUK RCO 122.6 (KENAI RADIO)
Ⓡ **ANCHORAGE CENTER APP/DEP CON** 125.2
RADIO AIDS TO NAVIGATION: NOTAM FILE BET.
BETHEL (H) (H) VORTACW 114.1 BET Chan 88 N60°47.09′ W161°49.46′ 249° 97.4 NM to fld. 105/14E.
COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

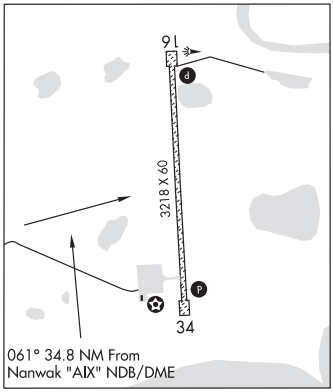
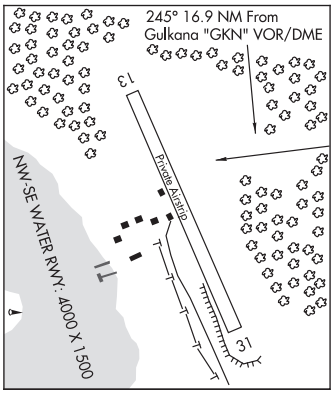
TOLSONA LAKE SPB (58A) 0 N UTC–9(–8DT) N62°06.80′ W146°02.46′ **ANCHORAGE**
2000 NOTAM FILE ENA
WATERWAY NW–SE: 4000X1500 (WATER)
SERVICE: S4
SEAPLANE REMARKS: Unattended. Airstrip on east side of lake is private. Public easement across pvt property to access Tolsona Lake. Wind sock is located at the NE corner of the lake.
AIRPORT MANAGER: 907-822-3433
COMMUNICATIONS: CTAF 122.9
RADIO AIDS TO NAVIGATION: NOTAM FILE GKN.
GULKANA (H) (H) VORW/DME 115.6 GKN Chan 103 N62°09.23′ W145°26.84′ 245° 16.9 NM to fld. 1549/17E.
COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.