CHRISTIANSEN LAKE SPB (AK8) 1 SE UTC–9(–8DT) N62°18.80′ W150°04.16′ **ANCHORAGE**

400 NOTAM FILE TKA

WATERWAY 14W–32W: 4000X1600 (WATER)

WATERWAY 04W–22W: 3800X2000 (WATER)

SERVICE: FUEL 100LL

SEAPLANE REMARKS: Attended continuously. All tfc remain east of SPB and over the lake. All traffic must use CTAF. Public docks located at north west end of lake, not at flight school.

AIRPORT MANAGER: 907-355-1067

COMMUNICATIONS: CTAF 123.6


RADIO AIDS TO NAVIGATION: NOTAM FILE TKA.

TALKEETNA (VH) (H) VORW/DME 116.2 TKA Chan 109 N62°17.90′ W150°06.32′ 029° 1.4 NM to fld. 568/19E.

VOR unusable:
000°–129° byd 40 NM
141°–147° byd 40 NM
277°–297° byd 30 NM blo 12,000′
297°–317° byd 40 NM

DME unusable:
057°–087° byd 30 NM blo 13,000′

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

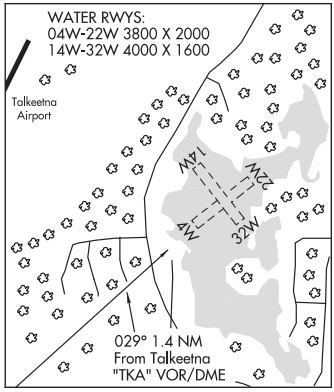

SECLUDED LAKE (49AK) PVT 20 S UTC–9(–8DT) N62°01.47′ W149°58.63′ **ANCHORAGE**

300 NOTAM FILE Not insp.

RWY 06–24: 2800X60 (GRVL)

AIRPORT REMARKS: Unattended. Rwy 06–24 CLOSED indefly. 60 ft trees N & S of cntrln. All ops PPR.

AIRPORT MANAGER: 601-209-0534

COMMUNICATIONS: CTAF 122.8

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

SONGLO VISTA (3AK3) PVT 15 NW UTC–9(–8DT) N62°33.83′ W150°13.23′ **ANCHORAGE**

825 NOTAM FILE Not insp.

RWY 15–33: 2100X30 (GRVL)

AIRPORT REMARKS: Unattended. Irregular snow removal, recommend visual inspection prior to use. Surface could be soft during spring breakup. Rwy center is lower than rwy ends. Bear and moose occasionally on and invof arpt.

AIRPORT MANAGER: 907-733-8000

COMMUNICATIONS: CTAF 122.9

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.