
TATALINA LRRS (TLJ)(PATL) AF 7 S UTC–9(–8DT) N62°53.69′ W155°58.68′
933 NOTAM FILE TLJ Not insp.

RWY 17–35: 3820X150 (GRVL) 1.1% up N
RWY 17: REIL. PAPI(P2R)—GA 5.0° TCH 52′. Hill.
RWY 35: REIL. PAPI(P2L)—GA 3.0° TCH 40′.

SERVICE: **MILITARY— LGT** Opr consly. PAPI Rwy 17 baffled and unusbl byd 5° right of cntrln.

MILITARY REMARKS: Attended Mon–Fri 1700–0200Z‡, CLOSED wkend and hols. Rwy 17 and 35 2 X 3 ft orange mkrs. Rwy 17–35 lateral slope; W edge higher than E edge. Exp turb both ends. Prkg fac rstrd to two C123. Aft initial ctc exp 30 min dla cond rprt. USAF fac; civ acft lndg pmt rqrd bfr arr D907–552–5282/C907–552–5282 or mail attn: 11 AF amgr 10471 20th Street Suite 218 Elmendorf AFD, AK, 99506. PPR all ops; mnm 1hr prior to dep for sit and no earlier than day travel D317–552–1106/1040/C907–552–1106/1040. Pax req coord bfr non emerg travel to site – D317–552–4935/1089/C907–552–4935/1089.

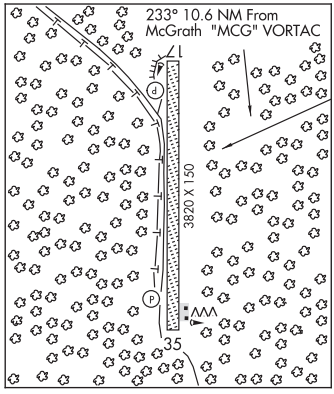

AIRPORT MANAGER: 907-552-7610

WEATHER DATA SOURCES: AWOS–3 (907) 552–1106 (WX CAM)

COMMUNICATIONS: CTAF 126.2
RCO 122.3 (KENAI RADIO)

RADIO AIDS TO NAVIGATION: NOTAM FILE MCG.

MC GRATH (H) (H) VORTACW 115.5 MCG Chan 102 N62°57.06′ W155°36.68′ 233° 10.6 NM to fld. 344/19E.
TACAN AZIMUTH unusable:
014°–019° byd 19 NM blo 7,000′
040°–050° byd 21 NM blo 5,000′
144°–194° byd 6 NM blo 9,000′
195°–223° byd 28 NM blo 6,000′
224°–261° byd 12 NM blo 10,000′
262°–294° byd 25 NM blo 7,000′
295°–314° byd 21 NM blo 8,000′
DME unusable:
014°–019° byd 19 NM blo 7,000′
040°–050° byd 21 NM blo 5,000′
144°–194° byd 6 NM blo 9,000′
195°–223° byd 28 NM blo 6,000′
224°–261° byd 12 NM blo 10,000′
262°–294° byd 25 NM blo 7,000′
295°–314° byd 21 NM blo 8,000′
VOR unusable:
171°–260° byd 6 NM
171°–260° within 6 NM blo 4,000′
261°–170° byd 20 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.