TOKEEN SPB (57A) 0 W UTC–9(–8DT) N55°56.23´ W133°19.60´ **KETCHIKAN**

00 NOTAM FILE KTN

WATERWAY NE–SW: 6000X400 (WATER)

SEAPLANE REMARKS: Unattended. Boats active in harbor vicinity, no seaplane float. Float pilings may damage seaplane wings. Kelp bed southeast of boat float.

AIRPORT MANAGER: 907-247-1201


COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE SIT.

LEVEL ISLAND (H) (H) VORW/DME 116.5 LVD Chan 112 N56°28.06´ W133°04.99´ 174° 32.9 NM to fld. 98/20E.

VOR unusable:
020°–050° byd 30 NM
105°–123° byd 28 NM
193°–201° byd 25 NM blo 5,000´
193°–201° byd 32 NM blo 6,000´
270°–324° byd 20 NM blo 10,100´
337°–356° byd 25 NM blo 8,000´
wx cam avbl at https://weathercams.faa.gov

DME unusable:
020°–050° byd 30 NM
083°–089° byd 35 NM
105°–123° byd 28 NM
124°–135° byd 35 NM blo 7,000´
193°–201° byd 25 NM blo 5,000´
193°–201° byd 32 NM blo 6,000´
270°–324° byd 20 NM blo 10,100´
337°–356° byd 25 NM blo 8,000´

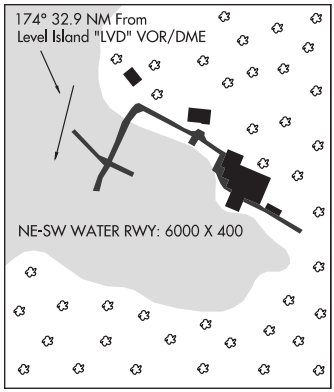

COMM/NAV/WEATHER REMARKS: For a LC to Ketchikan FSS dial 255–9481. For a LC to Juneau FSS dial 789–7380.

TOKSOOK BAY (OOK)(PAOO) 1 NE UTC–9(–8DT) N60°32.48´ W165°05.23´ **BETHEL**
L–3B
IAP

71 B NOTAM FILE OOK

RWY 16–34: 3200X75 (GRVL–DIRT) MIRL 0.7% up N

RWY 16: REIL. PAPI(P4L)—GA 4.0° TCH 37´.

RWY 34: REIL. PAPI(P4R)—GA 3.0° TCH 30´.

SERVICE: **LGT** ACTVT REIL Rwy 16 and Rwy 34; PAPI Rwy 16 and Rwy 34; MIRL Rwy 16–34, and rotating bcn—CTAF. Rwy 16 PAPI unusbl byd 9 deg left of cntrln.

AIRPORT REMARKS: Unattended. Rwy cond unmnt; rcmnd visual insp prior to use. Birds on and invof arpt. Vehicle and ATV tfc on rwy and ramp. Exp random turbulent winds.

AIRPORT MANAGER: 907-543-2498

WEATHER DATA SOURCES: AWOS–3P 119.275 (907) 560–7620. (WX CAM)

COMMUNICATIONS: CTAF 122.9

KIPNUK RCO 122.6 (KENAI RADIO)

Ⓡ **ANCHORAGE CENTER APP/DEP CON** 125.2

RADIO AIDS TO NAVIGATION: NOTAM FILE BET.

BETHEL (VH) (H) VORTACW 114.1 BET Chan 88 N60°47.09´ W161°49.46´ 249° 97.4 NM to fld. 105/14E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

