

AKUTAN

AKUTAN (7AK)(PAUT) 6 E UTC–9(–8DT) N54°08.68′ W165°36.25′ **DUTCH HARBOR**
129 B NOTAM FILE 7AK **H–2I, L–2J**
RWY 09–27: H4500X75 (ASPH) S–120, D–250 MIRL 0.4% up E **IAP**
SERVICE: **LGT** ACTVT MIRL Rwy 09–27—CTAF.
AIRPORT REMARKS: Attended 1600–0400Z‡. Arpt on Akun Island; Akutan shuttle avbl. Pilots must provide own rope.
AIRPORT MANAGER: 907-784-3476
WEATHER DATA SOURCES: AWOS–3P 121.55 (907) 300–6012. Wx sensor type: AWOS–3c. (WX CAM)
COMMUNICATIONS: CTAF 122.9
Ⓡ **ANCHORAGE CENTER APP/DEP CON** 121.4
GCO – 130.3; 5 CLICKS KENAI FSS; OCNL INOP)
RADIO AIDS TO NAVIGATION: NOTAM FILE DUT.
DUTCH HARBOR NDB/DME (HW) 283 DUT Chan 86 N53°54.31′ W166°32.87′ 057° 36.4 NM to fld. 272/9E.
DME portion unusable:
005°–080°
081°–330° byd 13 NM
331°–004° byd 15 NM
COMM/NAV/WEATHER REMARKS: For a toll free call to Cold Bay FSS dial 1–866–478–7250.

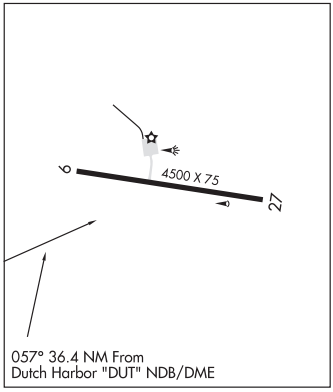

AKUTAN SPB (KQA) 0 S UTC–9(–8DT) N54°08.03′ W165°46.70′ **DUTCH HARBOR**
00 NOTAM FILE CDB
WATERWAY E–W: 10000X1000 (WATER)
SEAPLANE REMARKS: Unattended. Ops area Akutan Harbor; drift wood and debris. Dly hel shuttle fm 7AK arpt. SPB ramp unusbl for seaplane ops all tides. Lrg cobble rock beach otr side of harbor unsat for float acft; firm and acptbl for lrg wheeled amphibian acft.
AIRPORT MANAGER: 907-381-1000
COMMUNICATIONS: CTAF 122.9

ALAKANUK (AUK)(PAUK) 2 S UTC–9(–8DT) N62°40.98′ W164°43.33′ **BETHEL**
22 B NOTAM FILE ENA **H–1A, 2J, L–3B**
RWY 16–34: 4000X75 (GRVL–DIRT) MIRL
RWY 16: Brush.
SERVICE: **LGT** ACTIVATE MIRL Rwy 16–34 and Rot bcn–CTAF.
AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to landing.
AIRPORT MANAGER: (907) 625-1025
COMMUNICATIONS: CTAF 122.9
RADIO AIDS TO NAVIGATION: NOTAM FILE ENM.
EMMONAK (H) (H) VORW/DME 117.8 ENM Chan 125 N62°47.08′ W164°29.25′ 213° 8.9 NM to fld. 17/14E.
COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

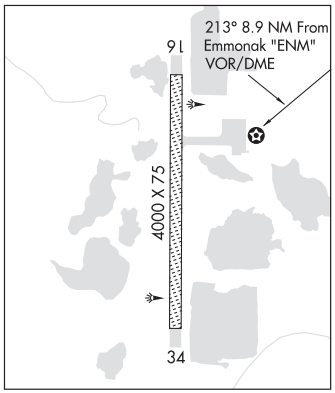

ALASKA RGNL HOSPITAL HELIPORT (See ANCHORAGE on page 42)