ALEKNAGIK

ALEKNAGIK SPB (Z33) 0 NW UTC–9(–8DT) N59°16.44′ W158°37.42′ **KODIAK**

7 NOTAM FILE DLG

WATERWAY E–W: 10000X1000 (WATER)

SERVICE: **FUEL** 100LL, MOGAS

SEAPLANE REMARKS: Unattended. Seaplane base used during winter months when river is frozen. Fuel avbl at marina. Acft may not take off or land within 400′ of shore in an area commencing 400′ east of Mosquito and Moody Points and running west along both shores of Lake Aleknagik State Recreation Site. Slow taxi only (5 MPH or less) within 150′ of shore.


AIRPORT MANAGER: 907-842-5988

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE DLG.

DILLINGHAM (H) (H) VORW/DME 116.4 DLG Chan 111 N58°59.65′ W158°33.13′ 338° 17.0 NM to fld. 81/15E.

COMM/NAV/WEATHER REMARKS: Dillingham FSS Local call 842–5275. For a toll free call to Kenai FSS dial 1–866–864–1737.

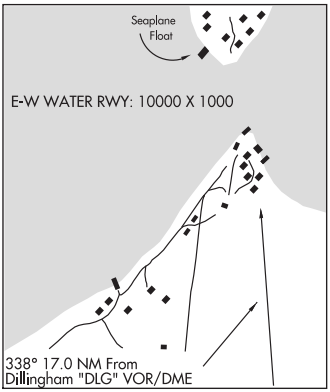

ALEKNAGIK /NEW (5A8) 1 E UTC–9(–8DT) N59°16.95′ W158°37.07′ **KODIAK**

63 NOTAM FILE DLG

RWY 15–33: 2030X60 (GRVL) 0.5% up NW

RWY 15: Tree.

RWY 33: Brush.

AIRPORT REMARKS: Unattended. Rwy cond not monitored; rcmd visual inspection prior to use. No snow removal. Be alert: rwy elevated above the surrounding terrain, no safety areas at either thld. The windsock is faded and below the tree line; may be unreliable. Segmented circle is overgrown and unuseable. Rwy 15–33 marked with orange 3′ cones. Be alert: float planes ldg and departing between north and south shores on the Aleknagik in the areas of Aleknagik Lodge and Mosquito Point. Trees on apch of Rwy 15, power lines on apch of Rwy 33. Loose rocks of rwy.


AIRPORT MANAGER: 907-842-5511

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE DLG.

DILLINGHAM (H) (H) VORW/DME 116.4 DLG Chan 111 N58°59.65′ W158°33.13′ 338° 17.5 NM to fld. 81/15E.

COMM/NAV/WEATHER REMARKS: Dillingham FSS Local call 842–5275. For a toll free call to Kenai FSS dial 1–866–864–1737.

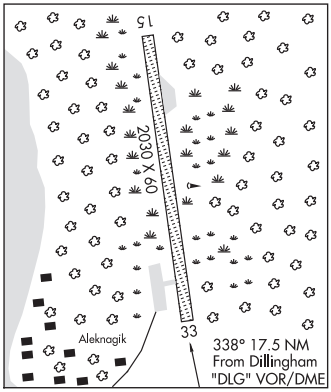

ALEKNAGIK MISSION STRIP (4AK7) PVT 1 NE UTC–9(–8DT) N59°16.86′ W158°35.83′ **KODIAK**

150 NOTAM FILE

RWY 09–27: 1500X35 (GRVL)

RWY 09: Tree/bushes.

RWY 27: Tree/bushes.

RWY 03–21: 1400X25 (GRVL)

RWY 21: Hill.

AIRPORT REMARKS: Unattended. Maint NA. Unusbl winter months. Rwy 03–21 5 ft bushes alg edges. Rwy 27 rocky and uneven; first 500 ft ireg out. Steep climb out fm rwy.

AIRPORT MANAGER: 907-242-4173

COMMUNICATIONS: CTAF 122.9

COMM/NAV/WEATHER REMARKS: Dillingham FSS Local call 842–5275. For a toll free call to Kenai FSS dial 1–866–864–1737.