FLYING CROWN (AK12) PVT 6 S UTC–9(–8DT) N61°06.36′ W149°51.83′ **ANCHORAGE**
144 NOTAM FILE Not insp.

RWY 15–33: 2000X75 (TURF)
RWY 15: Thld dsplcd 94′. Trees.
RWY 33: Thld dsplcd 352′. Trees. Rgt tfc.

AIRPORT REMARKS: Unattended. Ireg winter maint. Rwy cond unmnt; visual inspn rcmdd prior to use. Actv railroad parl to rwy; ops durg train tfc NA. Ctn: PAEW and sprinkler equip on & invof rwy. Rwy 15 first 80 ft slopes down.

AIRPORT MANAGER: 907-687-7488

COMMUNICATIONS: CTAF 122.9


RADIO AIDS TO NAVIGATION: NOTAM FILE ANC.

ANCHORAGE (VH) (H) VORW/DME 113.15 TED Chan 78(Y)
N61°10.07′ W149°57.61′ 125° 4.7 NM to fld. 93/18E.

VOR unusable:
010°–020° byd 40 NM
035°–039° byd 40 NM
040°–050° byd 40 NM blo 18,000′
041°–091° byd 25 NM blo 15,000′
051°–087° byd 40 NM
088°–098° byd 40 NM blo 18,000′
091°–096° byd 20 NM blo 15,000′
096°–121° byd 25 NM blo 12,500′
099°–108° byd 40 NM
109°–119° byd 40 NM blo 18,000′
120°–123° byd 40 NM
121°–146° byd 25 NM blo 9,000′
124°–134° byd 40 NM blo 10,000′
124°–134° byd 55 NM
135°–147° byd 40 NM
148°–158° byd 40 NM blo 9,000′
148°–158° byd 47 NM blo 12,000′
148°–158° byd 60 NM
159°–176° byd 40 NM
217°–220° byd 40 NM
289°–293° byd 40 NM blo 6,600′
289°–293° byd 64 NM blo 14,000′
294°–295° byd 40 NM

DME unusable:
041°–091° byd 25 NM blo 15,000′
091°–096° byd 20 NM blo 15,000′
096°–121° byd 25 NM blo 12,500′
121°–146° byd 25 NM blo 9,000′
196°–206° byd 25 NM blo 3,500′
206°–211° byd 25 NM blo 4,000′
211°–221° byd 25 NM blo 3,500′

VOR unusable:
310°–315° byd 40 NM
347°–349° byd 40 NM

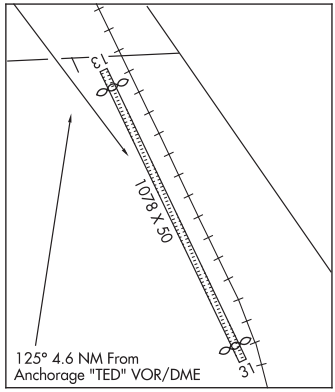

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.