

CAPE NEWENHAM LRSS (EHM)(PAEH) AF 1 SE UTC-9(-8DT) N58°38.89' W162°03.83'**KODIAK**
L-21, 3C
DIAP, AD

531 NOTAM FILE EHM Not insp.

RWY 15-33: 3945X150 (GRVL) 7.7% up SE**RWY 15:** REIL. PAPI(P2L)—GA 3.0° TCH 44'.**RWY 33:** Mtn.**SERVICE:** LGT RDO req on 126.2.**MILITARY REMARKS:** OFFL BUS ONLY; CLOSED to the pub. Attended dalgat hrs. Afd is clsd wkends and all fed hol. Arr 24 hr PPR and no ltr than 1 hr prior to

dep—D317-552-9419/9370/9370/C907-552-9419/9370. Pax req coord bfr non emerg travel to site —

D317-552-4935/1089/C907-552-4935/1089. USAF fac; civ opr must have Civ Acft Lndg Pmt bfr PPR; 30 days prior to Indg —

C907-552-5282/D317-552-5282 or mail to attn: 11 AF amgr

10471 20th street Suite 218, JBER, AK 99506. Failure to obtain and have onboard will result in fine and rptd to FAA FSDO and U.S.

Attorney's OFC IAW 32 CFR 855 and USAF operg instr. CTN: Rwy 15-33 on slp of 2305' mt. high trm both sides and S end. Successful go-around improbable. Rwy and parking apron on 7.9% grade. Estab

rdo ctc on 126.2 or 121.5 asap bfr Indg; exp 30 min dly for fld cond. Rwy 15 last 200' may have prkd acft.

RWY 15 last 200' may have prkd acft.**AIRPORT MANAGER:** 907-552-5105**WEATHER DATA SOURCES:** AWOS-3 (907) 552-9419 additional number 907-552-9370 ext 8.**COMMUNICATIONS:** CTAF 126.2**RCO 122.3** (KENAI RADIO)® **ANCHORAGE CENTER APP/DEP CON** 124.2 251.1**RADIO AIDS TO NAVIGATION:** NOTAM FILE EHM.**NDB/DME (HW)** 385 EHM Chan 18(Y) N58°39.36' W162°04.42' at fld. 212/12E.

NDB has no standby transmitter

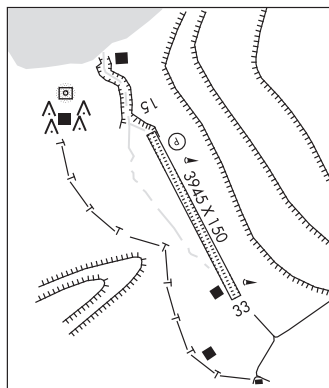
DME portion unusable:

050°-169° byd 10 NM blo 7,000'

170°-224°

225°-293° byd 10 NM blo 7,000'

294°-320° byd 30 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-800-864-1737. DME channel 18(Y) paired with VHF freq 108.15.**CAPE POLE SPB** (Z71) O W UTC-9(-8DT) N55°57.98' W133°47.80'**KETCHIKAN**

00 NOTAM FILE SIT

WATERWAY NW-SE: 10000X500 (WATER)**SEAPLANE REMARKS:** Unattended. No longer used as logging/seaplane operations. There is line across inlet at float. Operating area in Fishermans Harbor. Rocks in entrance. Beach contains large rocks unsafe for seaplane floats. Heavy seas are frequent.**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE SIT.**LEVEL ISLAND (H) (H) VOR/DME** 116.5 LVD Chan 112

N56°28.06' W133°04.99' 199° 38.5 NM to fld. 98/20E.

VOR unusable:

020°-050° byd 30 NM

105°-123° byd 28 NM

193°-201° byd 25 NM blo 5,000'

193°-201° byd 32 NM blo 6,000'

270°-324° byd 20 NM blo 10,100'

337°-356° byd 25 NM blo 8,000'

wx cam avbl at <https://weathercams.faa.gov>

DME unusable:

020°-050° byd 25 NM blo 11,000'

020°-050° byd 30 NM

083°-089° byd 35 NM

105°-123° byd 28 NM

121°-135° byd 35 NM blo 7,000'

193°-201° byd 25 NM blo 5,000'

193°-201° byd 32 NM blo 6,000'

270°-324° byd 20 NM blo 10,100'

337°-356° byd 25 NM blo 8,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-833-AK-BRIEF.