
COLDFOOT (CXF)(PACX) 0 WSW UTC–9(–8DT) N67°15.13′ W150°12.23′ **FAIRBANKS**
1049 B NOTAM FILE FAI **H–1A, L–4J**
RWY 02–20: 4011X75 (GRVL) MIRL 0.4% up N **IAP**
RWY 02: Brush.
RWY 20: Trees.
SERVICE: **LGT** ACTIVATE MIRL Rwy 02–20 and twy lgts—CTAF.
AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Cold temperature airport. Altitude correction required at or below –18C.
AIRPORT MANAGER: 907-451-2207
WEATHER DATA SOURCES: AWOS–3P 118.0 (907) 269–2771. (WX CAM)
COMMUNICATIONS: CTAF 122.9
COLDFOOT RCO 122.0 (FAIRBANKS RADIO)
ANCHORAGE CENTER APP/DEP CON 124.6 352.0
RADIO AIDS TO NAVIGATION: NOTAM FILE BTT.
BETTLES (H) (H) VORW/DME 116.0 BTT Chan 107 N66°54.30′ W151°32.15′ 036° 37.6 NM to fld. 637/20E.
VOR AZIMUTH & DME unusable:
047°–077° byd 24 NM
COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1–866–248–6516.



COOPER LANDING

QUARTZ CREEK (JLA) 3 E UTC–9(–8DT) N60°29.06′ W149°43.37′ **ANCHORAGE**
466 NOTAM FILE ENA
RWY 04–22: 2200X60 (GRVL–DIRT) 0.3% UP NE
RWY 04: Trees.
RWY 22: Brush.
AIRPORT REMARKS: Unattended. Ireg state maint, rcmd visual insp bfr lndg. Rwy 04–22 edges not mkd. Windsock blw treeline, may be unreliable.
AIRPORT MANAGER: 907-262-1187
COMMUNICATIONS: CTAF 122.9
RADIO AIDS TO NAVIGATION: NOTAM FILE ENA.
KENAI (H) (H) VORW/DME 117.6 ENA Chan 123 N60°36.88′ W151°11.71′ 081° 44.3 NM to fld. 115/19E.
VOR unusable:
348°–015° byd 20 NM
DME unusable:
355°–041° byd 35 NM blo 2,000′
COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

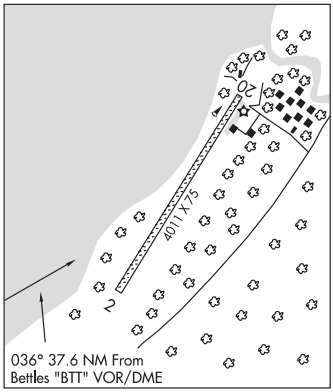