CORDOVA

CORDOVA MUNI (CKU) 1 E UTC–9(–8DT) N60º32.62´ W145º43.55´ **ANCHORAGE**

59 NOTAM FILE JNU

RWY 06–24: 1800X60 (GRVL) 0.5% up SW

RWY 06: Trees. Rgt tfc.

RWY 24: Road.

SERVICE: S4

AIRPORT REMARKS: Unattended. Rwy cond not monitored, recommend visual inspection prior to ldg. Birds invof arpt during summer months. Snow removal on irregular basis. Steep ridge and hill along North edge, strong East winds, rwy subj to strong downdrafts. Birds roost on South side, mountains 3 miles from AER 24. Busy residential road borders northside and parallels rwy. Larger grvl at AER24. Seaplane oprs in apch to Rwy 24. Rwy 06–24 marked with reflective cones. Rwy edge cones removed for winter 15 Oct thru 1 May.

AIRPORT MANAGER: 907-424-3202

COMMUNICATIONS: CTAF 122.5

RCO 123.6 122.2 (JUNEAU FSS)


MOUNT EYAK RCO 122.5 (JUNEAU FSS)

RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.

JOHNSTONE POINT (VH) (H) VORW/DME 116.7 JOH Chan 114
N60º28.86´ W146º35.96´ 063º 26.2 NM to fld. 48/18E.
wx cam

VOR unusable:
006º–050º byd 40 NM
061º–072º byd 40 NM
090º–124º byd 23 NM blo 8,000´
125º–188º byd 10 NM
189º–194º byd 40 NM blo 6,000´
189º–194º byd 58 NM
202º–209º byd 40 NM
324º–329º byd 40 NM
355º–005º byd 40 NM blo 14,000´
355º–005º byd 53 NM

DME unusable:
090º–124º byd 23 NM blo 12,000´
125º–191º byd 10 NM

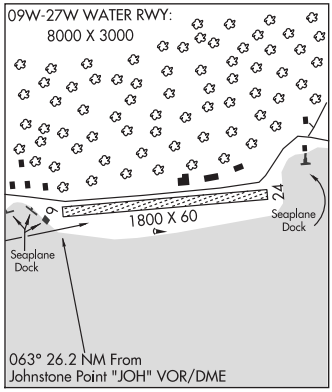

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1–866–297–2236.

WATERWAY 09W–27W: 8000X3000 (WATER)

SEAPLANE REMARKS: Unattended. No public seaplane dock. Public seaplane facilities at small boat harbor. Freeze up in winter; Tidewater remains open. Operates in Eyak Lake.