

KENDALLVILLE MUNI (C62) 2 N UTC-5(-4DT) N41°28.36' W85°15.65'

1004 B NOTAM FILE HUF

CHICAGO

L-281

IAP

RWY 10-28: H4400X75 (ASPH) S-12.5 MIRL**RWY 10:** REIL. PAPI(P2L)—GA 3.5° TCH 28'. Trees.**RWY 28:** REIL. PAPI(P2L)—GA 3.5° TCH 31'. Trees.**SERVICE:** S2 **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 10 and 28; PAPI Rwy 10 and 28; MRL Rwy 10-28—CTAF. Rwy 28 PAPI unusbl byd 9° right of cntrln.**AIRPORT REMARKS:** Attended Mon-Sat 1300-2200Z†, Sun

1700-2200Z†. Emergency-574-276-3933. Glider ops May-Nov 1400Z†-SS. Rwy 10-28 160' crops N of cntrln entire len. Rwy 10 5' trm down slope 100' fm rwy end.

AIRPORT MANAGER: 260-349-0350**WEATHER DATA SOURCES:** AWOS-3P 119.925 (260) 347-2967.**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **FORT WAYNE APP/DEP CON** 127.2 (SW/NW of active rwy) 132.15 (SE/NE of active rwy)**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago ARTCC at 630-906-8921.**RADIO AIDS TO NAVIGATION:** NOTAM FILE FWA.**FORT WAYNE (VH) (H) VORTACW** 117.8 FWA Chan 125

N40°58.74' W85°11.28' 360° 29.8 NM to fld. 793/6W.

DME unusable:

060°-070° byd 6 NM blo 4,000'

TACAN AZIMUTH unusable:

060°-070° byd 6 NM blo 4,000'

240°-245°

VOR unusable:

005°-016° byd 40 NM

017°-024° byd 40 NM blo 7,500'

017°-024° byd 52 NM

025°-035° byd 65 NM

090°-095° blo 5,800'

170°-199° byd 40 NM

233°-238° byd 40 NM

239°-246° byd 20 NM

256°-270° byd 40 NM

271°-274°

275°-300° blo 12,500'

331°-353° byd 50 NM

354°-004° byd 40 NM blo 4,000'

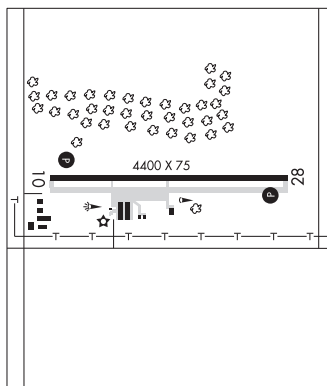
354°-004° byd 52 NM

WEBSTER LAKE (L) VORW 110.4 OLK N41°14.81' W85°29.84' O41° 17.3 NM to fld. 970/3W. NOTAM FILE HUF.

VOR unusable:

155°-050° blo 8,000'

155°-050° byd 15 NM

COMM/NAV/WEATHER REMARKS: APP CON sectorization based upon Fort Wayne rwy usage.**KENTLAND MUNI** (50I) 1 SE UTC-6(-5DT) N40°45.52' W87°25.75'

699 B NOTAM FILE HUF

CHICAGO

L-27D

IAP

RWY 09-27: H4004X60 (CONC) HIRL**RWY 09:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Crops.**RWY 27:** REIL. PAPI(P2L)—GA 3.0° TCH 45'. Crops.**SERVICE:** **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 09 & 27; PAPI Rwy 09 & 27; HIRL Rwy 09-27—CTAF. HIRL Rwy 09-27 preset low intst; incr intst—CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1400-2200Z†. Unatndd hol. Self serv fuel avbl. 100LL: self serv 24/7. Rwy 09-27: +37 ft unlgt pline 1267 ft fm west end mrkd with red balls; crops 125 ft N & S of cntrln whole length. Cold temperature airport. Altitude correction required at or below -6C.**AIRPORT MANAGER:** 219-863-7620**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **CHICAGO CENTER APP/DEP CON** 132.5**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago ARTCC at 630-906-8921.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HUF.**BOILER (H) (H) VORTACW** 115.1 BVT Chan 98 N40°33.37'

W87°04.16' 306° 20.4 NM to fld. 752/1E.

TACAN AZM/DME unusable:

298°-044° blo 2,800'

