

DOWAGIAC MUNI (C91) 1 NW UTC-5(-4DT) N41°59.58' W86°07.70'

747 B TPA—1547(800) NOTAM FILE LAN

RWY 09-27: H4700X100 (ASPH) S-30, D-60 MIRL

RWY 09: REIL. PAPI(P4L)—GA 3.0° TCH 35'. Tree.

RWY 27: REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees. Rgt tfc.

RWY 04-22: 2176X100 (TURF)

RWY 04: Tree.

RWY 22: Thld dsplcd 388'. Tree. Rgt tfc.

SERVICE: **FUEL** 100LL **LGT** ACTIVATE MIRL Rwy 09-27; PAPI Rwy 09 and Rwy 27; REIL Rws 09 and 27—CTAF.

AIRPORT REMARKS: Unattended. Deer and birds on and in/ovf arpt. Model RC acft ops E side of Rwy 04-22. Self svc fuel avbl 24 hrs. Admin bldg access, depress V, then III-II simultaneous, then I. Rwy 04-22 and dspl thld marked with 3' yellow cones.

AIRPORT MANAGER: 269-591-0054

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **SOUTH BEND APP/DEP CON** 118.55 (1030-0500Z± Sun-Fri, 1030-0445Z± Sat), other times ctc

Ⓡ **CHICAGO CENTER APP/DEP CON** 127.55


CLEARANCE DELIVERY PHONE: For CD ctc South Bend Apch at 574-251-2609. When South Bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

KEELER (L) DME 116.6 **ELX** Chan 113 N42°08.66' W86°07.36' 182° 9.1 NM to fld. 794.

DME unusable:

155°-010° byd 30 NM blo 3,500'

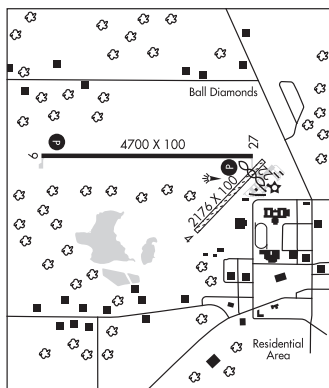

CHICAGO

L-281

IAP

DRUMMOND ISLAND

DRUMMOND ISLAND (DRM)(KDRM) 1 SW UTC-5(-4DT) N46°00.56' W83°44.64'

668 B NOTAM FILE DRM

RWY 08-26: H4000X75 (ASPH) MIRL

RWY 08: PAPI(P2L)—GA 3.0° TCH 35'. Thld dsplcd 650'. Trees.

RWY 26: PAPI(P2L)—GA 3.0° TCH 25'. Thld dsplcd 170'. Road.

RWY 01-19: H2500X150 (ASPH-TURF)

RWY 01: Trees.

RWY 19: Trees.

SERVICE: **FUEL** 100LL, MOGAS **LGT** ACTVT PAPI Rwy 08 and 26 and MIRL Rwy 08-26—CTAF.

AIRPORT REMARKS: Attended Mon-Sat 1300-2200Z±. Deer, birds, and wildlife on and in/ovf arpt. Golf carts and pedestrians xng Rwy 08-26 due to golf crs on both sides. D22 SPB lctd 1.5 NM North. Rwy 01-19 center 20' of rwy fm int Rwy 08-26 north to the hngr line is asph; rmndr of rwy turf. Rwy 01-19 marked with 3' yellow cones.

AIRPORT MANAGER: 906-493-5411

WEATHER DATA SOURCES: AWOS-3P 118.325 (906) 493-6410.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **TORONTO CENTER APP/DEP CON** 132.65

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE CIU.

SAULT STE MARIE (VH) (DH) VORW/DME 112.2 **SSM** Chan 59 N46°24.73' W84°18.89' 139° 33.9 NM to fld. 687/4W.

VOR unusable:

007°-034° byd 40 NM

052°-095° byd 40 NM

085°-105° byd 10 NM blo 5,000'

085°-105° byd 20 NM blo 8,000'

124°-134° byd 40 NM


157°-167° byd 40 NM blo 2,900'

157°-167° byd 46 NM

207°-216° byd 40 NM

329°-344° byd 40 NM

354°-004° byd 40 NM

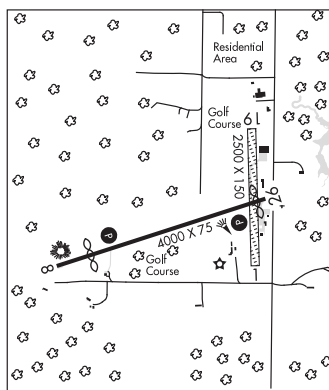

LAKE HURON

L-31C

IAP