

TWO HEARTED AIRSTRIP (6Y5) 20 N UTC-5(-4DT) N46°41.60' W85°25.33'

GREEN BAY

680 NOTAM FILE GRB

RWY 07-25: 2400X75 (TURF-DIRT)

RWY 07: Road.

RWY 25: Tree.

AIRPORT REMARKS: Unattended. Airport clsd Nov-May 15 and when snow covd exc for ski equipped acft. No snow removal.

Frequent high winds off Lake Superior. Rwy 07-25 rough and uneven, some soft areas. Rwy 07-25 intmt patches of turf and dirt.

AIRPORT MANAGER: 906-293-2926

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

NEWMANS (See KALAMAZOO on page 204)

NILES

JERRY TYLER MEML (3TR) 1 ENE UTC-5(-4DT) N41°50.15' W86°13.51'

CHICAGO

750 B NOTAM FILE LAN

L-281

RWY 15-33: H4100X75 (ASPH) S-25 MIRL

IAP

RWY 15: REIL. PAPI(P4L)—GA 4.0° TCH 35'. Thld dspcld 300'. Tree.

RWY 33: REIL. PAPI(P4L)—GA 4.0° TCH 37'. Trees.

RWY 04-22: H3316X55 (ASPH) S-8

RWY 04: Thld dspcld 898'. Tree.

RWY 22: Thld dspcld 750'. Trees.

SERVICE: FUEL 100LL LGT ACTIVATE REIL Rwy 15 and Rwy 33, PAPI Rwy 15 and Rwy 33, MIRL Rwy 15-33—CTAF. Rwy 15 PAPI unusable byd 5° left or right of centerline. Rwy 33 PAPI unusable byd 3° left or right of centerline.

AIRPORT REMARKS: Unattended. Deer and lrg birds on and invof arpt.

100LL self scv fuel. Rwy 15 trsn zone +51 ft obstn lgtd poles. Rwy 04-22 pavement cracked and broken.

AIRPORT MANAGER: 269-683-4700

COMMUNICATIONS: CTAF/UNICOM 122.8

® **SOUTH BEND APP/DEP CON** 118.55 (1030-0500Z± Sun-Fri,

1030-0445Z± Sat. other times ctc)

® **CHICAGO CENTER APP/DEP CON** 127.55

GCO 121.725 (South Bend CD and Flt Svcs)

CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc South Bend Apch at 574-251-2609. When South Bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

GIPPER (VH) (H) VORTACW 115.4 GU Chan 101 N41°46.12' W86°19.11' 046° 5.8 NM to fld. 804/OE.

TACAN AZIMUTH unusable:

245°-255°

276°-306° byd 25 NM blo 3,000'

307°-312° byd 25 NM blo 4,500'

313°-331° byd 25 NM blo 3,000'

DME unusable:

276°-306° byd 25 NM blo 3,000'

307°-312° byd 25 NM blo 4,500'


313°-331° byd 25 NM blo 3,000'

VOR unusable:

068°-070° byd 40 NM

202°-206° byd 40 NM

246°-252° byd 40 NM

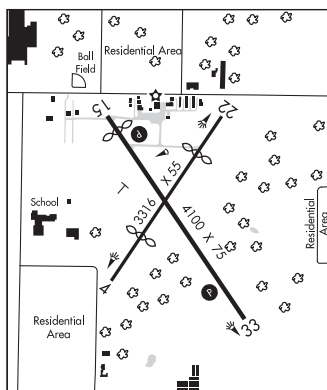

NORTH FOX ISLAND (6Y3) 1 NE UTC-5(-4DT) N45°28.93' W85°46.85'

GREEN BAY

639 NOTAM FILE LAN

RWY 07-25: 3001X100 (TURF)

RWY 07: Thld dspcld 804'. Trees.

RWY 25: Thld dspcld 999'. Trees.

AIRPORT REMARKS: Unattended. Arpt clsd Nov-Apr and when snow covd. Birds, wildlife, snakes on & invof arpt. Rwy soft in spring & after rain. Remote island, no services, no shelter, no cell phone coverage. Overfly the fld before entering tfc pat. Watch for acft taxiing and taking off before ldg. Safety briefing and pilot info avbl at <https://theraf.org/>. Rwy not plowed. Tall trees alquads. Rwy 07-25 & dthr mkd with 3' yellow cones. See DNR rules posted near parking. Wind indicator unrel due to trees.

AIRPORT MANAGER: 313-912-6161

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.