
PORT HURON

ST CLAIR CO INTL (PHN)(KPHN) 5 SW UTC–5(–4DT) N42°54.66′ W82°31.73′ **DETROIT**
650 B AOE NOTAM FILE PHN **H–10G, 11A, L–30F**
RWY 04–22: H5104X100 (ASPH–GRVD) S–40, D–55, 2D–90 HIRL **IAP**
RWY 04: MALSR. PAPI(P4L)—GA 3.0° TCH 50′. Tree.
RWY 22: REIL. PAPI(P4L)—GA 3.0° TCH 45′. Tree.
RWY 10–28: H4000X75 (ASPH) S–16 MIRL
RWY 10: REIL. PAPI(P4L)—GA 3.0° TCH 26′. Tree.
RWY 28: REIL. PAPI(P4L)—GA 3.5° TCH 33′. Tree.
SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT MALSR Rwy 04; REIL Rwy 22, 10, & 28; PAPI Rwy 10 & 28; HIRL Rwy 04–22; MIRL Rwy 10–28—CTAF. PAPI Rwy 04 & 22 opr consly.
AIRPORT REMARKS: Attended 1300–0000Z‡. Unatndd major hols. Deer and large birds on and invof arpt. Ldg fee. Coml & corporate ldg fee waived with fuel purchase. Tsatlc flts must ntfy U.S. Customs at 810–985–9541 one hr prior to entry into the U.S. Ntfy U.S. Dept of Agriculture at 810–985–6126 & amgr 24 hrs prior for disposal of acft intl trash. Flight Notification Service (ADCUS) avbl.
AIRPORT MANAGER: 810-364-6890
WEATHER DATA SOURCES: AWOS–3P 118.375 (810) 364–7787.
COMMUNICATIONS: CTAF/UNICOM 123.05
Ⓡ **SELFRIDGE APP/DEP CON** 119.6 (1200–0400Z‡ exc hols)
Ⓡ **CLEVELAND CENTER APP/DEP CON** 126.525 (0400Z–1200Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Selfridge Apch at 586-239-5706, when Apch clsd ctc Cleveland ARTCC at 440-774-0224/0490.
RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.
PECK (H) TACAN Chan 87 ECK (114.0) N43°15.35′ W82°43.08′ 165° 22.3 NM to fld. 810/7W.
PHURN NDB (LOMW) 332 PH N42°50.58′ W82°35.80′ 043° 5.1 NM to fld. 635/7W. NOTAM FILE PHN. NDB unmonitored.
ILS 110.9 I–PHN Rwy 04. Class IT. LOM PHURN NDB. Unmonitored. LOM unmonitored.

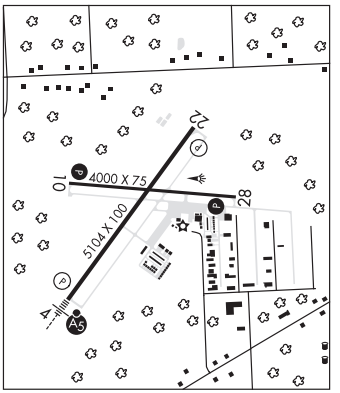

PRESQUE ISLE CO (See ROGERS CITY on page 232)

PRICES (See LINDEN on page 210)

PRICKETT–GROOMS FLD (See SIDNAW on page 241)

PULLMAN N42°27.96′ W86°06.29′ NOTAM FILE LAN. **CHICAGO**
(H) DME 112.1 PMM Chan 58 224° 9.6 NM to South Haven Area Rgnl. 640.
DME unusable:
Byd 35 NM blo 3,000′

RAY COMMUNITY (57D) 2 SE UTC–5(–4DT) N42°44.21′ W82°53.33′ **DETROIT**
632 B NOTAM FILE LAN **COPTER**
RWY 10–28: H2495X60 (ASPH) MIRL **IAP**
RWY 10: REIL. PAPI(P2L)—GA 3.0° TCH 40′.
RWY 28: PAPI(P2L). Thld dsplcd 210′. Tree.
RWY 01–19: H2202X123 (ASPH–TURF) 0.4% up N
RWY 01: Tree.
RWY 19: Thld dsplcd 140′.
SERVICE: S4 **FUEL** 100LL **LGT** ACTIVATE PAPI Rwy 10 and Rwy 28; MIRL Rwy 10–28—CTAF. ACTIVATE abn—CTAF.
AIRPORT REMARKS: Attended 1500–2100Z‡. Deer and lrg birds on and invof arpt. Ultralight ops. Fuel avbl H24 self svc via credit card machine in trml bldg. Rwy 01–19 mkd with 3′ yellow cones.
AIRPORT MANAGER: 586-999-8665
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **SELFRIDGE APP/DEP CON** 119.6 (1200–0400Z‡ exc hols)
Ⓡ **CLEVELAND CENTER APP/DEP CON** 126.525 (0400–1200Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Selfridge Apch at 586-239-5706, when Apch clsd ctc Detroit Apch at 734-955-1404.

