
LORAIN/ELYRIA

LORAIN CO RGNL (LPR)(KLPR) P (AR) 6 S UTC–5(–4DT) N41°20.66′ W82°10.66′ **DETROIT**
793 B NOTAM FILE LPR **H–10G, L–30G**
RWY 07–25: H5002X100 (ASPH–GRVD) S–80, D–110, 2S–175, 2D–180 HIRL **IAP**
RWY 07: MALSR. PAPI(P4L)—GA 3.0° TCH 52′. Tree.
RWY 25: REIL. PAPI(P4L)—GA 3.0° TCH 40′. Rgt tfc.
SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2 **LGT** ACTVT or incr intst MALSR Rwy 07; REIL Rwy 25; HIRL Rwy 07–25—CTAF. PAPI Rwy 07 and 25 opr consly; HIRL Rwy 07–25 preset low intst.
MILITARY— FUEL (NC–100LL, A). **FLUID** LPOX.
AIRPORT REMARKS: Attended Apr–Oct 1200–0300Z‡, Nov–Mar 1200–0200Z‡. Deer, birds and otr wildlife on and invof arpt. Pilots opr in Oberlin area reqd to avoid and remain well clear of Oberlin College due to music conservatory; all tfc ops north of arpt as per FAR Part 93, Subpart J. Transient hngr storage PPR. Landing fee. NOTE: See Regulatory Notices—Lorain County Airport Traffic Rule.
AIRPORT MANAGER: 440-323-7000
WEATHER DATA SOURCES: ASOS 118.925 (440) 323–7088.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **CLEVELAND APP/DEP CON** 125.35
CLNC DEL 125.7
CLEARANCE DELIVERY PHONE: For CD ctc Cleveland Apch at 216-352-2323.
RADIO AIDS TO NAVIGATION: NOTAM FILE CLE.
DRYER (VH) (DH) VORW/DME 113.6 DJB Chan 83 N41°21.48′ W82°09.72′ 226° 1.1 NM to fld. 780/5W.
VOR unusable:
001°–010° byd 40 NM
020°–024° byd 40 NM
080°–095° byd 40 NM
110°–120° byd 40 NM
135°–150°
155°–165°
185°–197°
210°–218°
219°–224° byd 40 NM
225°–235° byd 40 NM blo 11,000′
225°–235° byd 95 NM
225°–245° byd 20 NM blo 3,500′
246°–257° byd 40 NM
286°–355° byd 40 NM
DME unusable:
187°–197°
289°–310°
322°–332°
350°–060°
ILS 111.7 I–LQG Rwy 07. Class ID.

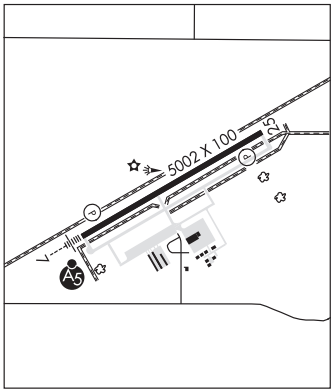

MAD RIVER AIRPARK (See TREMONT CITY on page 310)

MADISON CO (See LONDON on page 288)

MANNS N40°45.98′ W82°26.71′ NOTAM FILE MFD. **DETROIT**
NDB (MHW/LOM) 372 MF 321° 4.6 NM to Mansfield Lahm Rgnl. 1312/6W. **L–29A**