
CRANDON/STEVE CONWAY MUNI (Y55) 3 SW UTC–6(–5DT) N45°31.36′ W88°55.71′ **GREEN BAY**
1650 B NOTAM FILE GRB **L–14J**
RWY 12–30: H3550X75 (ASPH) S–12 MIRL 0.6% up NW **IAP**
RWY 30: Trees.
RWY 01–19: 2742X100 (TURF) 0.4% up N
SERVICE: **LGT** MIRL Rwy 12–30 preset to low SS–SR, incr intst and ACTVT—CTAF.
AIRPORT REMARKS: Unattended. Deer on and invof arpt. Rwy 01 mkd with yellow cones. Rwy 19 mkd with yellow cones. Rwy 12 markings faded. Rwy 30 markings faded.
AIRPORT MANAGER: 715-889-1057
COMMUNICATIONS: CTAF 122.9
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 133.65
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.
RADIO AIDS TO NAVIGATION: NOTAM FILE RHI.
RHINELANDER (VL) (DH) VORW/DME 115.05 RHI Chan 97(Y)
N45°38.03′ W89°27.47′ 104° 23.3 NM to fld. 1599/2E.
VOR unusable:
144°–150° byd 20 NM
144°–150° byd 6 NM blo 6,600′
190°–195° byd 40 NM blo 9,000′
196°–202° byd 40 NM
207°–210° byd 28 NM blo 6,600′
225°–234° byd 40 NM
245°–246° byd 49 NM
247°–248° byd 40 NM
303°–307° byd 49 NM
315°–322° byd 40 NM
DME unusable:
180°–195° byd 25 NM

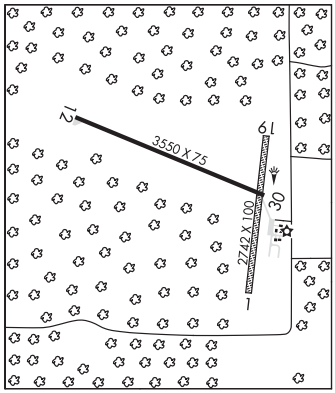

CRIVITZ MUNI (3D1) 3 SW UTC–6(–5DT) N45°12.88′ W88°04.40′ **GREEN BAY**
735 B NOTAM FILE GRB
RWY 09–27: 2545X80 (TURF) 0.3% up W
RWY 09: Thld dsplcd 595′. P–line.
RWY 27: Thld dsplcd 138′. Trees.
RWY 18–36: H2164X60 (ASPH) S–12 LIRL
RWY 18: Thld dsplcd 115′. Road.
RWY 36: Thld dsplcd 101′. Road.
SERVICE: **LGT** ACTIVATE LIRL 18–36—123.0. Rotating bcn–5 clicks on—123.0.
AIRPORT REMARKS: Unattended. Deer on and invof arpt. Rwy 09–27 not plowed for winter months. Rwy 18–36 to confirm snow removal ctc arpt manager. Rwy end 09 mkd with yellow cones. Rwy end 27 mkd with yellow cones.
AIRPORT MANAGER: (715) 927-2793
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.