
NORTON MUNI (NRN)(KNRN) 1 N UTC–6(–5DT) N39°51.03′ W99°53.68′ **WICHITA**
2384 B NOTAM FILE ICT **L–10H**
RWY 16–34: H4701X60 (CONC) HIRL 0.5% up NW **IAP**
RWY 16: REIL. PAPI(P2L)—GA 3.0° TCH 44′.
RWY 34: REIL. PAPI(P2L)—GA 3.0° TCH 43′.
RWY 08–26: 2117X125 (TURF)
RWY 08: Trees.
SERVICE: **FUEL** 100LL, JET A, A1+ **LGT** HIRL Rwy 16–34 opr consly. ACTVT PAPI Rwy 16 and 34—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1400–2300Z‡. Fuel 24 hr self–serve. No line of sight between rwy ends. Rwy 08–26 sfc rough. Rwy 16–34 rwy sfc rough due to uneven paving joints every 10 ft.
AIRPORT MANAGER: 785-877-2201
WEATHER DATA SOURCES: AWOS–3PT 118.275 (785) 871–4009.
COMMUNICATIONS: CTAF 122.9
Ⓡ **DENVER CENTER APP/DEP CON** 132.7
CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.
RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.
HILL CITY (VH) (H) VORTACW 113.7 HLC Chan 84 N39°15.52′ W100°13.55′ 015° 38.7 NM to fld. 2690/8E.
VOR unusable:
271°–274° byd 40 NM
279°–289° byd 40 NM blo 4,800′
279°–289° byd 47 NM



NORWICH (49K) 1 E UTC–6(–5DT) N37°27.33′ W97°50.02′ **WICHITA**
1494 NOTAM FILE ICT
RWY 17–35: 3230X80 (TURF) LIRL(NSTD)
RWY 17: P–line.
RWY 35: Thld dsplcd 180′. Railroad.
SERVICE: **LGT** NSTD LIRL Rwy 17–35, incorrect spacing.
AIRPORT REMARKS: Unattended. Rwy 35 dsplcd thld mkd with 2 lgts each side with painted tires. Irrigation pump and fuel tank 75′ left of cntrln Rwy 17 150′ S of thld. Power line Rwy 17 apch mkd with orange balls.
AIRPORT MANAGER: 620-704-3339
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Wichita Apch at 316-350-1520.

OAKLEY MUNI (OEL)(KOEL) 2 SE UTC–6(–5DT) N39°06.71′ W100°49.01′ **WICHITA**
3045 B NOTAM FILE ICT **H–5B, L–10G**
RWY 16–34: H5000X75 (CONC) S–30 MIRL 0.5% up NW **IAP**
RWY 16: REIL. PAPI(P2L)—GA 3.0° TCH 44′. Bldg.
RWY 34: REIL. PAPI(P2L)—GA 3.0° TCH 44′.
RWY 08–26: 2153X110 (TURF)
RWY 26: Road.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 16: TORA–5000 TODA–5000 ASDA–5000 LDA–5000
RWY 34: TORA–5000 TODA–5000 ASDA–5000 LDA–5000
SERVICE: S4 **FUEL** 100LL, JET A, A1+ **LGT** ACTVT REIL Rwy 16 and Rwy 34; PAPI Rwy 16 and Rwy 34; MIRL Rwy 16–34—CTAF. Rwy 16 PAPI unusable byd 8° right and 6° left of centerline. Rwy 34 PAPI unusable beyond 8° left of centerline.
AIRPORT REMARKS: Attended Mon–Fri 1400–2300Z‡. For svc after hrs call 785–672–0147. Fuel 24 hrs self–serve.
AIRPORT MANAGER: 785-672-0147
WEATHER DATA SOURCES: AWOS–3 118.325 (785) 671–4194.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **DENVER CENTER APP/DEP CON** 132.7
CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.
RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.
HILL CITY (VH) (H) VORTACW 113.7 HLC Chan 84 N39°15.52′ W100°13.55′ 244° 28.9 NM to fld. 2690/8E.
VOR unusable:
271°–274° byd 40 NM
279°–289° byd 40 NM blo 4,800′
279°–289° byd 47 NM

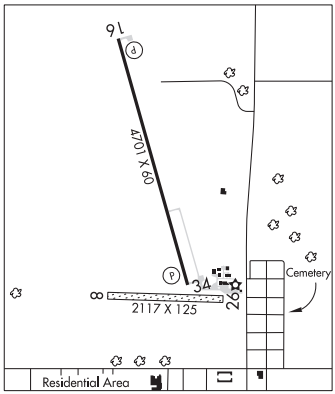