

HUTCHINSON MUNI/BUTLER FLD (HCD)(KHCD) 2 S UTC–6(–5DT) N44°51.59′ W94°22.95′ **TWIN CITIES**
1062 B NOTAM FILE HCD **L–12I, 14H**
RWY 15–33: H4000X75 (ASPH) MIRL **IAP**
RWY 15: REIL. PAPI(P4L)—GA 3.0° TCH 40′. Crops.
RWY 33: REIL. PAPI(P4L)—GA 3.0° TCH 40′. Crops.
SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT or incr intst REIL Rwy 15 and 33; PAPI Rwy 15 and 33; MIRL Rwy 15–33—CTAF. MIRL Rwy 15–33 preset low intst.
AIRPORT REMARKS: Attended Mon–Fri 1400–2300Z‡. 100LL avbl H24 via credit card. A avbl H24 via credit card.
AIRPORT MANAGER: 320-234-4473
WEATHER DATA SOURCES: AWOS–3 118.525 (320) 587–3343.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 127.1
GCO 121.725 (MINNEAPOLIS CENTER and FLIGHT SERVICES)
CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc Minneapolis ARTCC at 651-463-5588.
RADIO AIDS TO NAVIGATION: NOTAM FILE PNM.
DARWIN (L) DME 109.0 DWN Chan 27 N45°05.25′ W94°27.23′ 167° 14.0 NM to fld. 1130.

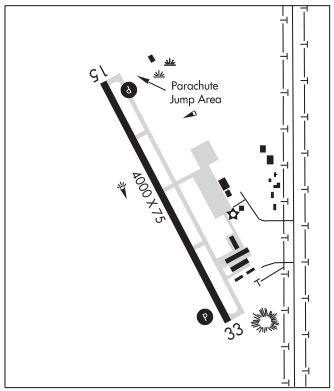

INTERNATIONAL FALLS

FALLS INTL/EINARSON FLD (INL)(KINL) 0 S UTC–6(–5DT) N48°33.94′ W93°24.13′ **TWIN CITIES**
1184 B AOE ARFF Index—See Remarks NOTAM FILE INL MON Airport **H–2J, L–14H**
RWY 13–31: H7400X150 (ASPH–GRVD) S–120, D–214, 2S–159, 2D–284, 2D/2D2–759 PCR 670 F/D/X/T HIRL **IAP, AD**
RWY 13: MALSR. PAPI(P4L)—GA 3.0° TCH 50′.
RWY 31: MALSR. PAPI(P4L)—GA 3.0° TCH 45′.
RWY 04–22: H2999X75 (ASPH) S–12.5 PCR 100 F/D/X/T
0.4% up NE No Part 121/Part 380 Ops
RUNWAY DECLARED DISTANCE INFORMATION
RWY 04: TORA–2999 TODA–2999 ASDA–2999 LDA–2999
RWY 13: TORA–7400 TODA–7400 ASDA–7400 LDA–7400
RWY 22: TORA–2999 TODA–2999 ASDA–2999 LDA–2999
RWY 31: TORA–7400 TODA–7400 ASDA–7400 LDA–7400
SERVICE: **FUEL** 100LL, JET A **LGT** ACTVT MALSR Rwy 13 and 31; HIRL Rwy 13–31—CTAF. PAPI Rwy 13 and 31 opr consly.
AIRPORT REMARKS: Attended dalgt hrs. Gulls and deer on and invof arpt. For attendant 0600–1100Z‡ call 218–283–2712. Fld conds unmon 0600–1100Z‡ call 218–283–2712. Class I, ARFF Index A. ARFF Index: ACR ops are NA in excess of 15 min bfr or aft skedd arr/dep times wo prior cdn with amgr. 24 hr PPR for unsked ACR ops gtr than 30 pax seats—call amgr. Rwy 04–22 clsd at ngt. Rwy 04–22 clsd drg winter months. 6500 ft of Rwy 13–31 is grooved. Southern 900 ft of Rwy 13–31 (Apch End Rwy 31) is not grooved. Flight Notification Service (ADCUS) available.

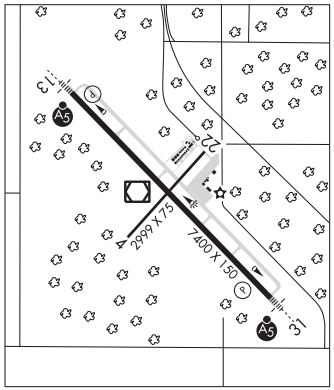

AIRPORT MANAGER: 218-283-4461
WEATHER DATA SOURCES: ASOS 120.0 (218) 210–0035.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 120.9
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC on freq. If una ctc Minneapolis ARTCC at 651-463-5588.
AIRSPACE: CLASS E.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE INL.

INTERNATIONAL FALLS (VL) (DH) VORW/DME 114.95 INL Chan 96(Y) N48°33.95′ W93°24.34′ at fld. 1180/6E.

VOR unusable:
164°–169° byd 40 NM blo 12,000′
170°–178° byd 35 NM blo 5,000′
170°–185° blo 4,000′
179°–185° byd 35 NM
262°–265° byd 40 NM
285°–290°
310°–351° byd 13 NM blo 4,000′

DME unusable:
260°–269° byd 15 NM blo 4,000′
270°–275° byd 30 NM blo 3,000′

ILS 109.1 I–ABK Rwy 13. Class IB. Unmonitored.

ILS 111.95 I–INL Rwy 31. Class IA. LOC unusable wi 0.2 NM inbd. LOC unusable byd 26° left and right of course. Autopilot cpd apch NA blw 1,731′.

INTL FALLS SPB (Ø9I) 1 E UTC–6(–5DT) N48°36.35′ W93°22.25′ **TWIN CITIES**
1110 TPA—1710(600) AOE NOTAM FILE PNM

WATERWAY 05W–23W: 5000X1000 (WATER)

WATERWAY 08W–26W: 5000X1000 (WATER)

SERVICE: **FUEL** 100LL

SEAPLANE REMARKS: Unattended. Unicom located at Falls Intl–Einarson Fld. Acft requiring U.S. Customs ctc Princeton FSS on 123.6 15 minutes prior to arr also call U.S. Customs at 218–283–2541 prior to tkf. Pilots ctc Falls Intl–Einarson Fld on 122.8 for aeronautical advisory information for the seaplane base. Phone located in customs building. Pilots maintain 500′AGL TPA separation from tfc at Falls Intl–Einarson Fld arpt 2 miles southwest. Use caution for a +105′ lookout twr north of facility on the Canadian side of the river. Windsock located at border patrol helipad approx 1/2 mile west of seaplane dock.

AIRPORT MANAGER: 218-283-4461

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

INTL FALLS SPB (See INTERNATIONAL FALLS on page 176)

INVER GROVE HGTS

WIPLINE SPB (Ø9Y) 2 SE UTC–6(–5DT) N44°49.65′ W93°00.52′ **TWIN CITIES**
687 NOTAM FILE PNM

WATERWAY 17W–35W: 8000X500 (WATER)

WATERWAY 35W: Rgt tfc.

SERVICE: S2 **FUEL** 100LL, JET A

SEAPLANE REMARKS: Attended continuously. 100LL: For fuel call amgr. Floating debris on river at all times. River channel marked by buoys.

AIRPORT MANAGER: 612-286-6612

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis Apch at 612-713-4016.

RADIO AIDS TO NAVIGATION: NOTAM FILE INL.

INTERNATIONAL FALLS (VL) (DH) VORW/DME 114.95 INL Chan 96(Y) N48°33.95′ W93°24.34′ at fld. 1180/6E.

VOR unusable:
164°–169° byd 40 NM blo 12,000′
170°–178° byd 35 NM blo 5,000′
170°–185° blo 4,000′
179°–185° byd 35 NM
262°–265° byd 40 NM
285°–290°
310°–351° byd 13 NM blo 4,000′

DME unusable:
260°–269° byd 15 NM blo 4,000′

ISEDOR IVERSON (See MC GREGOR on page 184)
