
HARLAN CO LAKE SPB (See ALMA on page 287)

HARTINGTON MUNI/BUD BECKER FLD (ØB4) 2 SE UTC–6(–5DT) N42°36.19′ W97°15.21′ OMAHA
1388 B NOTAM FILE OLU L–12H
RWY 13–31: H3950X60 (CONC) MIRL 0.3% up SE IAP
RWY 13: PAPI(P2L)—GA 3.5° TCH 46′. Tree.
RWY 31: PAPI(P2L)—GA 3.25° TCH 40′. Thld dsplcd 400′.
RWY 03–21: 2150X125 (TURF) 0.6% up SW
SERVICE: S4 **FUEL** 100LL **LGT** ACTVT PAPI Rwy 13 & 31, MIRL Rwy 13–31—CTAF.
AIRPORT REMARKS: Attended continuously. For fuel call 402–254–7316 or 402–841–0486. Rwy 03–21 not plowed during winter months.
AIRPORT MANAGER: 402-841-0486
COMMUNICATIONS: CTAF 122.9
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 125.025
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.
RADIO AIDS TO NAVIGATION: NOTAM FILE YKN.
YANKTON (L) DME 111.4 YKN Chan 51 N42°55.10′ W97°23.10′ 163° 19.8 NM to fld. 1301.
DME unusable:
249°–264° byd 24 NM blo 2,800′



HARVARD STATE (Ø8K) 2 NE UTC–6(–5DT) N40°39.08′ W98°04.79′ OMAHA
1815 B NOTAM FILE OLU L–10I
RWY 14–32: 3873X150 (TURF) IAP
RWY 17–35: H3722X60 (ASPH) MIRL
SERVICE: **FUEL** 100LL **LGT** ACTIVATE MIRL Rwy 17–35—CTAF.
AIRPORT REMARKS: Unattended. Amgr lctd offsite; call for assistance 402–266–1890. 100LL: ctc amgr for fuel; cash or ck only 402–266–1890.
AIRPORT MANAGER: 402-266-1890
COMMUNICATIONS: CTAF 122.9
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 119.4
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.
RADIO AIDS TO NAVIGATION: NOTAM FILE HSI.
HASTINGS (L) DME 108.8 HSI Chan 25 N40°36.27′ W98°25.78′ 080° 16.2 NM to fld. 1957.

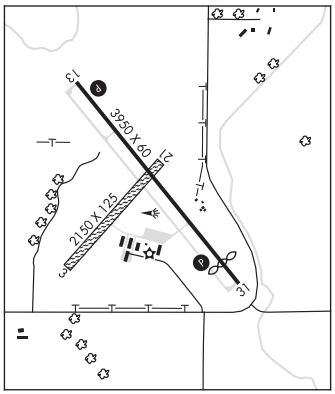