
CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE DVL.
(DH) DME 114.75 DVL Chan 94(Y) N48°06.91′ W98°54.75′ at fld. 1448.
ILS 108.7 I–VKE Rwy 31. Unmonitored.

DICKINSON/THEODORE ROOSEVELT RGNL (DIK)(KDIK) 5 S UTC–7(–6DT) N46°48.03′ W102°48.27′ **BILLINGS H–2H, L–14F IAP, AD**
2592 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE DIK
RWY 14–32: H7301X150 (CONC–GRVD) S–60, D–90, 2D–90 PCR 440 R/D/W/T HIRL
RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 50′. Pole.
RWY 32: MALSR. PAPI(P4L)—GA 3.0° TCH 50′. Road.
RWY 07–25: H4700X75 (ASPH–GRVD) S–16, D–20 PCR 60 F/D/X/T MIRL 0.4% up E No Part 121/Part 380 Ops
RWY 07: REIL. PAPI(P4L)—GA 3.0° TCH 27′.
RWY 25: REIL. PAPI(P4L)—GA 3.0° TCH 28′. Road.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 07: TORA–4700 TODA–4700 ASDA–4700 LDA–4700
RWY 14: TORA–7301 TODA–7301 ASDA–7301 LDA–7301
RWY 25: TORA–4700 TODA–4700 ASDA–4700 LDA–4700
RWY 32: TORA–7301 TODA–7301 ASDA–7301 LDA–7301
SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT MALSR Rwy 32; REIL Rwy 14, 07 & 25; PAPI Rwy 14 & 32; HIRL Rwy 14–32—CTAF. PAPI Rwy 07 & 25 opr consly SS–SR. MIRL Rwy 07–25 preset on low intst dusk–0500Z‡; to incr intst aft 0500Z‡—CTAF.

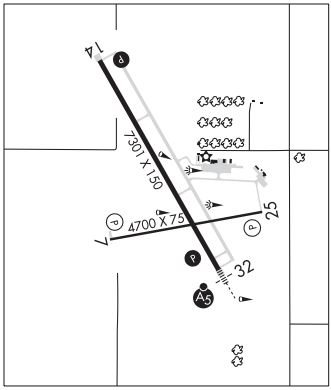

AIRPORT REMARKS: Attended 1400–2300Z‡. For svc aft hrs call 701–264–9966. Crop dusting operations invof arpt. Airfield sfc conds unmon btn 0600 and 1130Z‡. Haying operations adjacent to all surfaces Jun–Sep. PAEW on movement areas during winter (Oct–Apr). TPA—single engine 3602 (1010); multiengine 4102 (1510). Conc apron for heavy acft parking.
AIRPORT MANAGER: 701-483-1062
WEATHER DATA SOURCES: ASOS 118.375 (701) 227–0280.
COMMUNICATIONS: CTAF/UNICOM 123.0
RCO 122.2 (GRAND FORKS RADIO)
Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 124.25
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC on freq. If una ctc Minneapolis ARTCC at 651-463-5588.
AIRSPACE: CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE DIK.
(VH) (H) VORTACW 112.9 DIK Chan 76 N46°51.60′ W102°46.41′ 186° 3.8 NM to fld. 2527/14E.
VOR unusable:
010°–020° byd 52 NM
180°–215° byd 25 NM
260°–270°
ILS/DME 108.3 I–DIK Chan 20 Rwy 32. Class IE. Unmonitored.

DRAYTON MUNI (D29) 3 N UTC–6(–5DT) N48°37.11′ W97°10.55′ **TWIN CITIES**
798 B NOTAM FILE GFK
RWY 17–35: H2596X60 (ASPH) S–4 LIRL
RWY 35: Thld dsplcd 505′.
SERVICE: **LGT** LIRL Rwy 17–35 opr dusk–0600Z‡; after 0600Z‡ ACTVT LIRL Rwy 17–35 —CTAF.
AIRPORT REMARKS: Unattended. For svc call 701–454–6588. Confirm winter conditions and snow removal before use, call 701–454–3590 or 701–454–6588. Rwy 17 cultivated fld 20 ft fm thr. Rwy 35 mkgs heavily worn & faded.
AIRPORT MANAGER: 701-520-1219
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

DUNN CO WEYDAHL FLD (See KILLDEER on page 342)
