

ELKHART—MORTON CO (EHA)(KEHA) 1 E UTC-6(-5DT) N37°00.05' W101°52.80'

WICHITA

3622 B NOTAM FILE ICT

L-15B

RWY 17-35: H4907X75 (CONC) S-30, D-30 PCN 11 R/C/X/U MIRL

IAP

RWY 17: PAPI(P4L)—GA 3.0° TCH 40'. Pole.

RWY 35: PAPI(P4L)—GA 3.0° TCH 44'. Road. Rgt ttc.

RWY 04-22: H4900X60 (ASPH) PCN 5 F/C/Y/U MIRL 0.6% up SW

RWY 04: PAPI(P4L)—GA 3.0° TCH 38'. Road. Rgt ttc.

RWY 22: PAPI(P4L)—GA 3.0° TCH 39'. Tower.

SERVICE: FUEL 100LL LGT ACTVTPAPI Rwy 04, 17, 22 and 35; MIRL Rwy 04-22 and 17-35—CTAF.

AIRPORT REMARKS: Unattended. For fuel call 620-697-2803. Rwy 22 controlling obstruction—pivot irrigation twr (moving when in operation). Cold temperature airport. Altitude Correction required at or below -4C.

AIRPORT MANAGER: (620) 360-6100

WEATHER DATA SOURCES: AWOS-3P 118.025 (620) 697-4973.

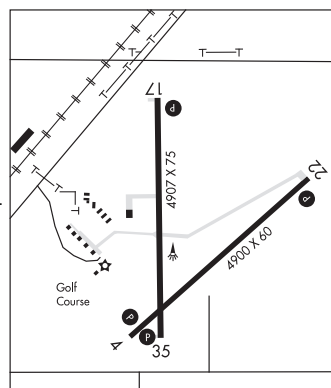
COMMUNICATIONS: CTAF/UNICOM 122.8

⑧ KANSAS CITY CENTER APP/DEP CON 134.0

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

RADIO AIDS TO NAVIGATION: NOTAM FILE LBL.

LIBERAL (H) TACAN Chan 70 LBL (112.3) N37°02.66' W100°58.27' 256° 43.7 NM to fld. 2881/11E.

TACAN AZIMUTH unusable:
240°-280°**ELLINWOOD MUNI** (1K6) 2 NW UTC-6(-5DT) N38°22.37' W98°35.92'

WICHITA

1797 NOTAM FILE ICT

RWY 17-35: 2550X100 (TURF-GRVL) MIRL

RWY 17: Road.

RWY 08-26: 2150X150 (TURF)

RWY 26: Road.

AIRPORT REMARKS: Unattended. After hrs contact city of Ellinwood 620-564-2211. Rwy 08-26 soft after rain. 2 ft ditch at Rwy 26 thld. Large drainage ditch 400 ft south of Rwy 35. Rwy 17-35 patches of grassy vegetation/gravel mixture AER 17 along cntrn. NOTE: Special Notices Section—Model Rocket activity.

AIRPORT MANAGER: 620-564-3161

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

ELLSWORTH MUNI (9K7) 1 N UTC-6(-5DT) N38°45.06' W98°13.75'

WICHITA

1633 B NOTAM FILE ICT

L-10H

RWY 17-35: H4500X75 (CONC) PCN 5 F/C/Y/U MIRL 0.5% up N

IAP

RWY 17: REIL. PAPI(P4L)—GA 3.0° TCH 40'.

RWY 35: REIL. PAPI(P4L)—GA 3.0° TCH 40'.

RWY 13-31: 1955X100 (TURF)

SERVICE: FUEL 100LL LGT ACTVT REIL Rwy 17 & 35, PAPI Rwy 17 & 35; MIRL Rwy 17-35—CTAF.

AIRPORT REMARKS: Unattended arpt ph 785-472-5608. Fuel avbl 24 hr self serve. For asst 785-472-4416. Rwy 35 apch—Tall fences, towers & stadium flood lights. Cold temperature airport. Altitude Correction required at or below -8C.

AIRPORT MANAGER: 785-472-5566

WEATHER DATA SOURCES: AWOS-3PT 119.675 (785) 472-9746.

COMMUNICATIONS: CTAF/UNICOM 122.7

⑧ KANSAS CITY CENTER APP/DEP CON 134.9

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

RADIO AIDS TO NAVIGATION: NOTAM FILE SLN.

SALINA (VH) (H) VORTACW 117.1 SLN Chan 118 N38°55.51' W97°37.28' 243° 30.3 NM to fld. 1316/7E.

VOR unusable:

017°-026° byd 40 NM

315°-016° byd 15 NM blo 6,000'

DME unusable:

300°-042° byd 15 NM blo 6,000'

