
HAGERSTOWN RGNL/RICHARD A HENSON FLD (HGR)(KHGR) P (AR) 4 N UTC–5(–4DT) **WASHINGTON**
N39°42.51′ W77°43.59′ **H–10H, 12I, L–29D, A**
703 B ARFF Index—See Remarks NOTAM FILE HGR **IAP, AD**

RWY 09–27: H7000X150 (ASPH–GRVD) S–120, D–250, 2S–175, 2D–550 PCR 750 F/A/X/T HIRL 0.3% up E
RWY 09: REIL. PAPI(P4L)—GA 3.0° TCH 55′.
RWY 27: MALSR. PAPI(P4L)—GA 3.0° TCH 55′.
RWY 02–20: H3165X100 (ASPH) S–120, D–250, 2S–127, 2D–515 PCR 600 F/A/X/T MIRL 0.3% up N No Part 121/Part 380 Ops
RWY 02: REIL. PAPI(P2L)—GA 4.0° TCH 53′.
RWY 20: REIL. PAPI(P2L)—GA 4.0° TCH 33′.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 02: TORA–3165 TODA–3165 ASDA–3165 LDA–3165
RWY 09: TORA–7000 TODA–7000 ASDA–7000 LDA–3165
RWY 20: TORA–3165 TODA–3165 ASDA–3165 LDA–3165
RWY 27: TORA–7000 TODA–7000 ASDA–7000 LDA–7000
SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2, 3, 4 **LGT** When ATCT clsd ACTVT MALSR Rwy 27; REIL Rwy 09; HIRL Rwy 09–27—CTAF. **MILITARY— FUEL** A, A+ (Avbl 1000–0300Z‡, C301–791–9119, OT 3 hr PN C301–730–4700/301–730–4100, fee $100/hr.) (NC–100LL) **OIL** O–128

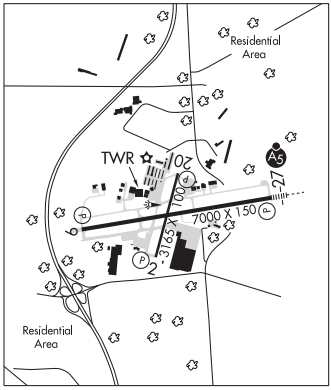

AIRPORT REMARKS: Attended 1000–0300Z‡. Airport unattnd 0300–1000Z‡. Birds on and invof arpt. Ultralight act 12 NM east to 5000′ MSL. Low level mil acft 10 NM north on VR708 operating east to west. Fuel avbl 1000–0300Z‡, call 301–791–9119. DOD contract fuel avbl. Rwy 02–20 CLOSED when ATCT clsd. Class I, ARFF Index B. ARFF Index C avbl upon req; ctc amgr. PPR 24 hrs for unsked ACR opns with more than 30 psgr seats call amgr 240–313–2764. PPR 24 hr prior to aces the museum apn. For more info ctc museum mgr at 240–520–3417. Twy P not avbl for air carrier ops. Ldg fee.
AIRPORT MANAGER: 240-313-2764
WEATHER DATA SOURCES: ASOS 126.375 (301) 745–3497.
COMMUNICATIONS: CTAF 120.3 **UNICOM** 122.95
Ⓡ **POTOMAC APP/DEP CON** 126.825
TOWER 120.3 (1200–0300Z‡) **GND CON** 120.8
CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc Potomac Apch at 866-709-4993.
AIRSPACE: CLASS D svc 1200–0300Z‡; other times CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE HGR.
(L) VORW 109.8 HGR N39°41.86′ W77°51.34′ 091° 6.0 NM to fld. 563/7W.
VOR unusable:
251°–280° byd 16 NM blo 4,000′
281°–300° byd 24 NM blo 8,000′
351°–050°
ST THOMAS (L) TACAN Chan 97 THS (115.0) N39°55.99′ W77°57.06′ 149° 17.0 NM to fld. 2338/7W. NOTAM FILE AOO.
ILS/DME 111.9 I–UYK Chan 56 Rwy 09. ILS unavbl when ATCT clsd.
ILS/DME 111.9 I–HGR Chan 56 Rwy 27. Class IE. OM/LOM OTS indef.

HARFORD CO (See CHURCHVILLE on page 95)

HAVRE DE GRACE SPB (MØ6) 1 E UTC–5(–4DT) N39°32.49′ W76°04.18′ **WASHINGTON**
00 NOTAM FILE DCA
WATERWAY E–W: 8000X200 (WATER)
WATERWAY E: Bridge.
WATERWAY N–S: 8000X200 (WATER)
WATERWAY S: Bridge.
SEAPLANE REMARKS: Attended May–Nov dawn–dusk. Birds on and invof arpt. +100 ft bridge aprxly 3500 ft north of N/S rwy.
AIRPORT MANAGER: (410) 258-9648
COMMUNICATIONS: CTAF/UNICOM 123.0
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.