SALISBURY

BENNETT (1N5) 4 NW UTC–5(–4DT) N38°24.77′ W75°37.02′ **WASHINGTON**

46 B NOTAM FILE DCA

RWY 17–35: 3171X95 (TURF) LIRL

RWY 17: APAP(PNIL)—GA 4.0° TCH 23′. Thld dsplcd 240′. Trees.

RWY 35: APAP(PNIL)—GA 5.0°. Thld dsplcd 941′. Trees.

RWY 08–26: 2302X95 (TURF)

RWY 08: Thld dsplcd 800′. Road.

RWY 26: Thld dsplcd 300′. Trees.

SERVICE: **LGT** Dusk–0400Z‡. ACTVT LIRL Rwy 17–35 and bcn—CTAF.

AIRPORT REMARKS: Attended dawn–dusk. Ultralight act on and invof arpt. Birds and wildlife on and invof arpt. +375 ft lgtd ant 3200 ft L of Rwy 35 thr on L downwind. Driveway xng at apch end Rwy 17 and Rwy 26. Rwy 08 and Rwy 26 dthr mkd with 3 orange cones. Rwy 17 and Rwy 35 thr and dthr mkd with lgts and cones. Rwy 17–35 +60 ft trees mid–point both sides of rwy. +70′ trees mid–point both sides rwy 17–35.

AIRPORT MANAGER: (443) 880-7428

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **PATUXENT APP/DEP CON** 127.95 (1200–0400Z‡ Mon–Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

SALISBURY–OCEAN CITY WICOMICO RGNL (SBY)(KSBY) 4 SE UTC–5(–4DT) N38°20.37′ W75°30.49′ **WASHINGTON**

H–10I, 12I, L–34F, 36I, A

IAP, AD

54 B Class I, ARFF Index B NOTAM FILE SBY

RWY 14–32: H7600X100 (ASPH–CONC–GRVD) S–76, D–126, 2S–146, 2D–423, 2D/2D2–749 PCR 400 F/D/X/T HIRL

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 53′.

RWY 32: MALSR. PAPI(P4L)—GA 3.0° TCH 53′.

RWY 05–23: H5000X100 (ASPH–GRVD) S–56, D–76, 2S–83, 2D–142 PCR 130 F/C/X/T MIRL

RWY 05: REIL. PAPI(P4L)—GA 3.0° TCH 45′. Tree.

RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 45′. Tree.


RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA–5000 TODA–5000 ASDA–5000 LDA–5000

RWY 14: TORA–7600 TODA–7600 ASDA–7600 LDA–7600

RWY 23: TORA–5000 TODA–5000 ASDA–5000 LDA–5000

RWY 32: TORA–7600 TODA–7600 ASDA–7600 LDA–7600

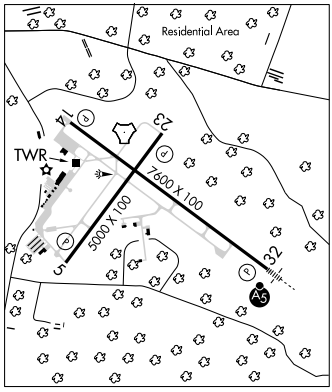

SERVICE: S4 **FUEL** 100LL, JET A **LGT** When ATCT clsd ACTVT MALSR Rwy 32; REIL Rwy 05, 14, and 23; MIRL Rwy 05–23; HIRL Rwy 14–32; Twy lgts—CTAF. PAPI Rwy 05, 14, 23, and 32 opr consly.

AIRPORT REMARKS: Attended 0930–0530Z‡. Mil trng act, deer and birds on and invof arpt. FBO hrs 1200–0000Z‡. For services after hrs call 410–749–0323. 24 hr PPR rqr for unsked ACR ops ctc amgr. Twy G south 950 ft clsd to acft wingspan more than 49 ft. Rwy 05 nonstd reflective ldg zone mkr panels adj to the rwy. Rwy 23 nonstd reflective ldg zone mkr panels adj to the rwy.

AIRPORT MANAGER: 410-548-4827

WEATHER DATA SOURCES: ASOS 118.325 (410) 341–0868.

COMMUNICATIONS: CTAF 119.425 **UNICOM** 122.95

Ⓡ **PATUXENT APP/DEP CON** 127.95 (1200–0400Z‡ Mon–Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

TOWER 119.425 (1100–0330Z‡) **GND CON** 123.775 **CLNC DEL** 123.775 (1100–0330Z‡) 132.45 (when SBY twr clsd)

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd if una on freq ctc Patuxent Apch at 301-342-3740, when Apch clsd ctc Potomac Apch at 866-640-4124.

AIRSPACE: CLASS D svc 1100–0330Z‡; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE SBY.

(L) TACAN Chan 49 SBY (111.2) N38°20.70′ W75°30.63′ at fld. 48/12W.

TACAN AZIMUTH unusable:
009°–055° byd 20 NM
261°–285° blo 6,000′
294°–007° blo 5,000′

DME unusable:
009°–055° byd 20 NM
261°–285° blo 6,000′
294°–007° blo 5,000′

ILS 108.7 I–SBY Rwy 32. Class IC. Unmonitored when ATCT clsd.