JAFFREY AIRFIELD SILVER RANCH (AFN)(KAFN) 1 SE UTC–5(–4DT) N42°48.31′ W72°00.18′ **NEW YORK L–32G, 33C IAP**

1040 NOTAM FILE AFN

RWY 16–34: H2982X134 (ASPH–TURF) S–8 LIRL 0.9% up N

RWY 16: Trees.

RWY 34: Thld dsplcd 582′. Trees.

SERVICE: S2 **FUEL** 100LL **LGT** First 582′ Rwy 34 not lgtd. PPR for nstd LIRL call 603–532–8870.

AIRPORT REMARKS: Attended 1300Z‡–dusk. Wildlife on and invof arpt. Ultralight act on arpt. Rwy 16–34 touch and go ldgs prohibited. Rwy 16–34 50′ cntr ptn of entr rwy is asph, rmng 42′ per side is turf/grvl for entr rwy len. Parl twy serves hngr/ramp only—no aces to Rwy 34. Calm wind rwy is Rwy 34. Rwy 34 nstd cntrln and dthr.

AIRPORT MANAGER: 603-532-8870

WEATHER DATA SOURCES: ASOS 135.875 (603) 532–6195.


COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **BOSTON CENTER APP/DEP CON** 123.75

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BDR.

GARDNER (VL) (L) VORW/DME 116.95 GDM Chan 116(Y) N42°32.76′ W72°03.49′ 023° 15.7 NM to fld. 1280/14W.

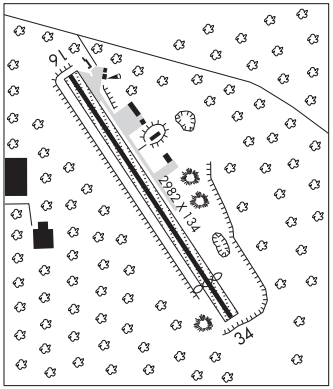

KEENE

DILLANT/HOPKINS (EEN)(KEEN) P (ANG) 2 S UTC–5(–4DT) N42°53.90′ W72°16.25′ **NEW YORK H–11D, 12K, L–32G, 33C IAP, AD**

488 B NOTAM FILE EEN

RWY 02–20: H6201X100 (ASPH) D–60 PCN 40 F/C/X/T HIRL

RWY 02: MALSR. PAPI(P4L)—GA 3.0° TCH 39′. Tree.

RWY 20: PAPI(P4L)—GA 3.0° TCH 50′. Trees.

RWY 14–32: H4001X75 (ASPH) S–25 PCN 8 F/C/X/T MIRL 0.3% up SE

RWY 14: REIL. Trees.

RWY 32: REIL. Thld dsplcd 1100′. Trees.

SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2, 3, 4 **LGT** PAPI Rwy 20 OTS indefly. ACTVT MALSR Rwy 02; HIRL Rwy 02–20 and MIRL Rwy 14–32—CTAF. **MILITARY— FUEL** (NC–100LL – Avbl H24 with credit card; A – After hr fone C603–357–7600.)

NOISE: Noise abatement proc: hel tfc avoid residential areas drctly N of Rwy 02–20 and SW of arpt. Hel tfc limit mult clsd pat ops.

AIRPORT REMARKS: Attended Mon–Fri 1200–0000Z‡, Sat–Sun 1200–2200Z‡. Wildlife on and invof arpt. 100LL avbl 24 hrs with credit card. For jet fuel aft hrs call 603–357–7600. Grass areas not mntnd for tkofs and ldgs. No eng run–ups on trml NW apn. Ldg fee for all turbine powered acft. Cold temperature airport. Altitude correction required at or below –20C.

AIRPORT MANAGER: 603-357-9835

WEATHER DATA SOURCES: AWOS–3PT 119.025 (603) 358–6424.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ **BOSTON CENTER APP/DEP CON** 123.75

CLNC DEL 121.6

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BDR.

ILS 108.9 I–EEN Rwy 02. Class IA. Localizer unusable 25° right of course.

