
PISECO (KØ9) 1 N UTC–5(–4DT) N43°27.20′ W74°30.90′ NEW YORK
1703 NOTAM FILE BUF L–32G
RWY 04–22: H3016X60 (ASPH) S–8 MIRL 0.3% up NE IAP
RWY 04: REIL. PAPI(P2L)—GA 3.8° TCH 52′. Trees. Rgt tfc.
RWY 22: REIL. Trees.

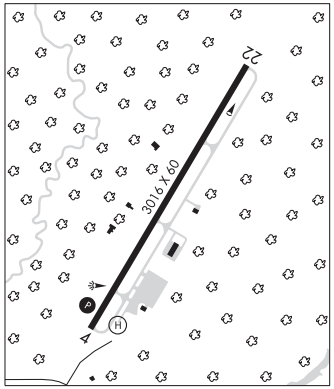

SERVICE: **FUEL** 100LL **LGT** ACTVT REIL Rwy 04 and 22; PAPI Rwy 04; MIRL Rwy 04–22; helipad perimeter lgts—CTAF. Rwy 04 PAPI unusbl byd 9 degs right of cntrln. Rwy lgts (electric eye over–ride).
AIRPORT REMARKS: Attended May–Oct, Sat–Sun 1400–2200Z‡. Airport unattended Nov–Apr. Seagulls–deer–bears occasionally vcty rwy during summer months. Expect turbulence and downdrafts during periods of strong crosswinds. Area not maintained for ski equipped acft. Rwy 04–22 may be unusable due to snow accumulation Nov–Apr. Check NOTAMS or call 518–548–3415 for afld conditions. Acft departing Rwy 22 are requested to maintain rwy heading until past island checkpoint, prior to making left turn. Acft arriving maintain rgt downwind heading until past island checkpoint.
AIRPORT MANAGER: 518-548-3415
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **BOSTON CENTER APP/DEP CON** 135.25
CLEARANCE DELIVERY PHONE: For CD ctc Syracuse Apch at 315-455-6218.
RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.
UTICA (L) TACAN Chan 49 UCA (111.2) N43°01.59′ W75°09.87′ 060° 38.3 NM to fld. 1420/12W.

HELIPAD H1: H40X40 (ASPH) PERIMETER LGTS
HELIPAD H1: RLLS.
HELIPORT REMARKS: Helipad H1 perimeter lgts

PLATEAU SKY RANCH (See EDINBURG on page 198)

PLATTSBURGH INTL (PBG)(KPBG) 3 S UTC–5(–4DT) N44°39.06′ W73°28.09′ MONTREAL
234 B ARFF Index—See Remarks NOTAM FILE PBG H–11C, 12K, L–32G
RWY 17–35: H11759X200 (ASPH–GRVD) S–119, D–174, 2S–175, 2D–510, IAP, AD
2D/2D2–780 PCR 548 F/C/W/T HIRL
RWY 17: REIL. PAPI(P4L)—GA 3.0° TCH 40′. Tree. Rgt tfc. 0.8% down.
RWY 35: MALSR. PAPI(P4L)—GA 3.0° TCH 55′. Tree. 0.5% up.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 17: TORA–11759 TODA–11759 ASDA–11759 LDA–11759
RWY 35: TORA–11759 TODA–11759 ASDA–11759 LDA–11759
SERVICE: S1 **FUEL** 100LL, JET A **OX** 3 **LGT** ACTIVATE MALSR Rwy 35 REIL Rwy 17, HIRL Rwy 17–35 and twy lgts—CTAF.
AIRPORT REMARKS: Attended 1030–0230Z‡. Deer and birds on and invof arpt. Skydiving opns southeast of arpt, invof FBO. All surfaces work in progress, grass cutting May thru Nov. During periods of snow removal ops Nov 1–May 1 acft ctc 122.7 or 518–335–3279 15 min prior to ldg. Class I, ARFF Index B. PPR 24 hrs for unsked ACR opns with more than 30 psgr seats. Index E coverage is avbl upon req. 24 hrs prior notice rqrd. Call amgr at 518–565–4008 or 518–335–3735. PPR and ARFF Index E call 518–335–3735. Acft depg Rwy 35 fly rwy hdg to dep end, otfc avoid trml and trml apn. Expect downdrafts and turbulence during periods of strong cross winds. Acft arriving or departing PBG must announce intentions on CTAF. Hel trng prohibited W of Rwy 17–35, 1500′ radius. User fee arpt. Ldg fees for acft over 12,500 lbs max gross ldg weight; no ldg fee for government acft. US Cust avbl Mon–Fri, 1300–2100Z‡. PPR 24 hours for aft hours; ctc CBP Supvr @ 518–324–5617.
AIRPORT MANAGER: 518-565-4794
WEATHER DATA SOURCES: ASOS 132.225 (518) 957–5905.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **BURLINGTON APP/DEP CON** 121.1 (1030–0500Z‡)
Ⓡ **BOSTON CENTER APP/DEP CON** 120.35 (0500–1030Z‡)
CLNC DEL 121.85
CLEARANCE DELIVERY PHONE: For CD ctc Burlington Apch at 802-657-4413, when Apch clsd ctc Boston ARTCC at 603-879-6859.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

BURLINGTON (VL) (L) VORW/DME 117.5 BTV Chan 122 N44°23.83′ W73°10.96′ 336° 19.5 NM to fld. 417/15W.

VOR unusable:
030°–086° byd 40 NM
075°–132° byd 30 NM blo 9,000′
087°–097° byd 40 NM blo 9,000′
087°–097° byd 49 NM
098°–169° byd 40 NM
133°–165° byd 30 NM blo 8,000′
170°–180° byd 40 NM blo 5,800′
170°–180° byd 47 NM
181°–196° byd 40 NM
244°–292° byd 40 NM
340°–350° byd 40 NM blo 6,000′
351°–010° byd 40 NM

DME unusable:
075°–132° byd 30 NM blo 9,000′
133°–165° byd 30 NM blo 8,000′

ILS/DME 109.7 I–FQV Chan 34 Rwy 35. Class IE.

PLAZZ N42°52.43′ W78°48.99′ NOTAM FILE GBD. **DETROIT**

NDB (LOMW) 204 GB 052° 5.5 NM to Buffalo Niagara Intl. 593/9W. **L–31E**

POTSDAM MUNI/DAMON FLD (PTD)(KPTD) 2 E UTC–5(–4DT) N44°40.60′ W74°56.91′ **MONTREAL**

474 B TPA—1274(800) NOTAM FILE PTD **L–32G**

RWY 06–24: H3704X75 (ASPH) S–30 MIRL **IAP**

RWY 06: REIL. PAPI(P2L)—GA 3.0° TCH 42′. Tree.

RWY 24: REIL. PAPI(P2L)—GA 3.0° TCH 41′. Trees.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 06 and 24; PAPI Rwys 06 and 24; MIRL Rwy 06–24; twy lgts—CTAF.

NOISE: Noise abatement procs in effect–left turn when able departing Rwy 24.

AIRPORT REMARKS: Unattended. Deer on and invof arpt. Expect flt training ops invof arpt. Fuel 24 hr self–serve. Rwy condition not monitored, recommend visual inspection prior to use.

AIRPORT MANAGER: 315-268-1000

WEATHER DATA SOURCES: AWOS–3P 118.325 (315) 265–6106.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **BOSTON CENTER APP/DEP CON** 135.25

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE MSS.

MASSENA (H) TACAN Chan 88 MSS (114.1) N44°54.87′ W74°43.36′ 228° 17.2 NM to fld. 198/14W.

NDB (MHW) 400 PTD N44°43.40′ W74°52.96′ 239° 4.0 NM to fld. 360/14W. NOTAM FILE PTD.

NDB unusable:
Byd 20 NM