ROUND LAKE (W57) 2 E UTC–5(–4DT) N42°55.87′ W73°46.25′ **NEW YORK**
178 NOTAM FILE BTV
RWY 14–32: 1927X76 (TURF) 1.0% up SE
RWY 14: Tree.
RWY 32: Trees.
AIRPORT REMARKS: Attended on call; ctc 518–527–2996. Deer on and invof arpt. Arpt clsd to itinerant acft Nov–May. Rwy 14–32 has 80′ trees rgt and left of centerline in primary sfc. Rwy 14–32 soft during spring (Mar–Jun). Military helicopters and ultralight acft use rwy. Access to arpt from lake overgrown. Ctc arpt mgr prior to seaplane arrival.
AIRPORT MANAGER: 518-899-6316
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.


• • • • • • • • • • • • • • • • • • • •

WATERWAY 14W–32W: 4000X600 (WATER)

ROYALTON (See GASPORT on page 205)

SARANAC LAKE

ADIRONDACK RGNL (SLK)(KSLK) 4 NW UTC–5(–4DT) N44°23.12′ W74°12.37′ **MONTREAL**
1663 B LRA ARFF Index—See Remarks NOTAM FILE SLK **H–11C, 12K, L–32G**
RWY 05–23: H6573X150 (ASPH–GRVD) S–120, D–206, 2S–92, 2D–349, 2D/2D2–834 PCR 363 F/B/X/T HIRL 0.3% up NE **IAP, AD**
RWY 05: PAPI(P4L)—GA 3.0° TCH 35′. Trees.
RWY 23: MALSR. Trees.
RWY 09–27: H3997X100 (ASPH) S–101, D–177, 2S–92, 2D–326 PCR 349 F/A/X/T MIRL
RWY 09: Trees.
RWY 27: Thld dsplcd 400′. Trees.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 05: TORA–6573 TODA–6573 ASDA–6573 LDA–6573
RWY 09: TORA–3997 TODA–3997 ASDA–3997 LDA–3997
RWY 23: TORA–6573 TODA–6573 ASDA–6333 LDA–6333
RWY 27: TORA–3997 TODA–3997 ASDA–3997 LDA–3597

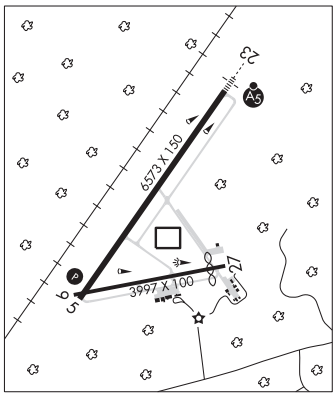

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT MALSR Rwy 23, HIRL Rwy 05–23, MIRL Rwy 09–27 and twy lgts—CTAF. PAPI Rwy 05 opr consly.
AIRPORT REMARKS: Attended May–Oct 1100–0200Z‡. Nov–Apr 1100–0100Z‡. For arpt attendant after hrs call 518–637–7329. Rwy/twy/apron conds not mnt outside of nml atnd hrs. All sfcs work in prog; grass cutting Apr thru Oct. Class IV, ARFF Index A. PPR 48 hr for unscheduled acft ops with more than 30 passenger seats call arpt manager 518–891–4600 ext 106. Index B coverage is avbl. Twy B unavbl to acft with wingspan 79′ and abv. Abv ground twy edge lgts adjacent to Twy B tie down apron area. Rwy 09 nstd markings, thld markings 400′ from rwy end. Cold temperature airport. Altitude correction required at or below –32C. Ldg fee.
AIRPORT MANAGER: 518-891-4600
WEATHER DATA SOURCES: ASOS 124.175 (518) 897–7532.
COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **BOSTON CENTER APP/DEP CON** 120.35
CLEARANCE DELIVERY PHONE: For CD if una to ctc on freq, ctc Boston ARTCC at 603-879-6859.
RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.
ILS 108.9 I–SLK Rwy 23. Class IA.

SARANAC LAKE N44°23.07′ W74°12.27′ NOTAM FILE SLK. **MONTREAL**
(DH) VORW/DME 114.85 SLK Chan 95(Y) at Adirondack Rgnl. 1647/14W. **L–32G**
DME unusable:
102°–107° byd 31 NM blo 11,500′
108°–111° byd 31 NM
112°–129° byd 31 NM blo 10,500′
310°–315° byd 36 NM blo 9,300′
Blw 8,600′
VOR unusable:
295°–305° byd 15NM blo 9,000′
295°–305° byd 25NM

SARATOGA CO (See SARATOGA SPRINGS on page 241)