

EASTON

BRADEN AIRPARK (N43) 3 N UTC–5(–4DT) N40°44.53′ W75°14.58′ **NEW YORK**
397 B NOTAM FILE IPT **L–33A, 34H**
RWY 18–36: H1956X165 (ASPH–TURF) LIRL(NSTD) 0.5% up N **IAP**
RWY 18: PAPI(P2L)—GA 3.0° TCH 33′. Thld dsplcd 192′. Trees.
RWY 36: PAPI(P2R)—GA 3.0° TCH 33′. Trees.
SERVICE: S2 **FUEL** 100LL **LGT** Rwy 18–36 NSTD LIRL, lgts spaced at 400′ intervals.
AIRPORT REMARKS: Attended 1300–2130Z‡. Rwy 18–36 1956 ft by 50 ft asph aligned in center of 165 ft turf strip. Acft may not be visible on all parts of fld. 24 hr self serve fuel avbl.
AIRPORT MANAGER: 610-231-5270
COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **ALLENTOWN APP/DEP CON** 119.65 (3000′ and blo) 124.45 (abv 3000′)
CLEARANCE DELIVERY PHONE: For CD ctc Allentown Apch at 800-728-6322.
RADIO AIDS TO NAVIGATION: NOTAM FILE ABE.
ALLENTOWN (L) (L) VORTACW 117.5 FJC Chan 122 N40°43.60′ W75°27.28′ 094° 9.7 NM to fld. 681/10W.
TACAN AZIMUTH & DME unusable:
061°–299° byd 30 NM blo 4,000′
300°–060° byd 26 NM blo 4,500′
VOR unusable:
021°–189° byd 10 NM
190°–260° blo 9,000′
190°–260° byd 24 NM
261°–306° byd 9 NM blo 4,000′
307°–349°
350°–020° blo 3,500′
350°–020° byd 33 NM blo 4,000′

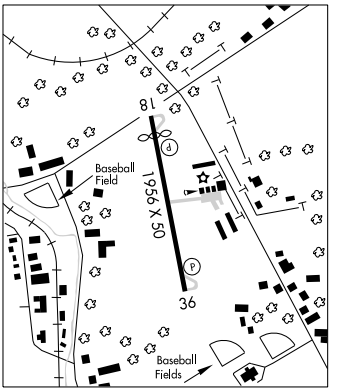

EBENSBURG (9G8) 3 SW UTC–5(–4DT) N40°27.68′ W78°46.52′ **DETROIT**
2099 B NOTAM FILE AOO **L–29D**
RWY 07–25: H3204X50 (ASPH) S–12.5 MIRL 0.6% up NE **IAP**
RWY 07: Trees.
RWY 25: Trees.
RWY 11U–29U: 1636X150 (GRASS) 1.9% up E
RWY 29U: Tree.
SERVICE: **FUEL** 100LL **LGT** ACTIVATE MIRL Rwy 07–25 and twy lgts—CTAF.
AIRPORT REMARKS: Attended irregularly. 24 hr self–serve fuel avbl. Deer on and invof arpt. Rwy 11U–29U for ultralight use only. Rwy 11U–29U rwy boundary marked with yellow cones. Rwy 07–25 bsc rwy markings.
AIRPORT MANAGER: 202-262-6593
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **JOHNSTOWN APP/DEP CON** 121.2 (1200–0400Z‡) or ctc 814–532–5960.
Ⓡ **CLEVELAND CENTER APP/DEP CON** 124.4 (0400–1200Z‡) or ctc Cleveland ARTCC at 440–774–0234.
CLEARANCE DELIVERY PHONE: For CD ctc Johnstown Apch at 814-532-5960, when Apch clsd ctc Cleveland ARTCC at 440-774-0213.
RADIO AIDS TO NAVIGATION: NOTAM FILE AOO.
REVLOC (DH) DME 114.75 REC Chan 94(Y) N40°32.79′ W78°44.82′ 194° 5.3 NM to fld. 2340.

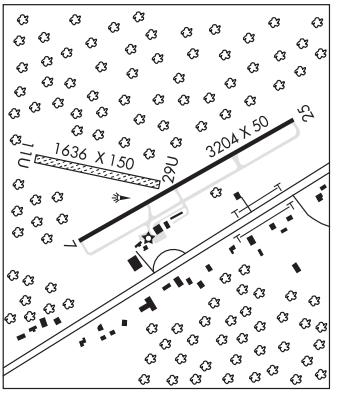

EIGHTY FOUR

BANDEL (22D) 3 SE UTC–5(–4DT) N40°07.84′ W80°05.77′ **DETROIT**
1210 NOTAM FILE AOO
RWY 01–19: 2260X100 (TURF–DIRT) 0.3% up N
RWY 01: Hill.
RWY 19: Trees.
AIRPORT REMARKS: Attended irregularly. PAEW adj Rwy 01–19 indefly. 250 ft high terrain 3450 ft north of Rwy 19. Rwy 01–19 marked with flush white bucket lids boundary markers. Rwy 01 150 ft dthr mkd with flush orange bucket lids. Rwy 19 1330 ft dthr mkd with flush orange bucket lids. Rwy not maintained durg winter months.
AIRPORT MANAGER: 412-877-4584
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Pittsburgh Apch at 412-472-5591.