
BARRE/MONTPELIER

EDWARD F KNAPP STATE (MPV)(KMPV) 3 W UTC–5(–4DT) N44°12.21′ W72°33.73′ **MONTREAL**
1166 B NOTAM FILE MPV MON Airport **H–11D, 12K, L–32G**
RWY 17–35: H5000X100 (ASPH) S–31, D–70, 2S–88 MIRL **IAP**
1.5% up S
RWY 17: MALSR. PAPI(P4L)—GA 3.0° TCH 46′. Trees.
RWY 35: REIL. Thld dsplcd 502′. Antenna.
RWY 05–23: H3001X75 (ASPH) S–30, D–46 MIRL 1.0% up SW
SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT MALSR Rwy 17; MIRL Rwy 17–35—CTAF.
AIRPORT REMARKS: Attended 1300–2200Z‡. Fld cond not mon when unatndd. Cold temperature airport. Altitude correction required at or below –8C.
AIRPORT MANAGER: 802-272-7725
WEATHER DATA SOURCES: ASOS 132.675 (802) 229–2037.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **BOSTON CENTER APP/DEP CON** 135.7
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.
AIRSPACE: CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE MPV.
MONTPELIER (VL) (DH) VORW/DME 116.9 MPV Chan 116
N44°05.13′ W72°26.96′ 342° 8.6 NM to fld. 2086/16W.
VOR unusable:
010°–020° byd 25 NM blo 7,500′
015°–031° byd 40 NM
032°–042° byd 40 NM blo 5,000′
032°–042° byd 65 NM
043°–060° byd 40 NM
043°–070° byd 40 NM blo 9,100′
045°–060° byd 24 NM blo 8,500′
170°–182° byd 40 NM
210°–275° byd 40 NM
DME unusable:
043°–070° byd 40 NM
045°–060° byd 24 NM blo 8,500′
ILS/DME 108.7 I–MPV Chan 24 Rwy 17. Class IA. DME unmonitored. Localizer unusable byd 28° right of course.
COMM/NAV/WEATHER REMARKS: UNICOM base station not manned continuously.

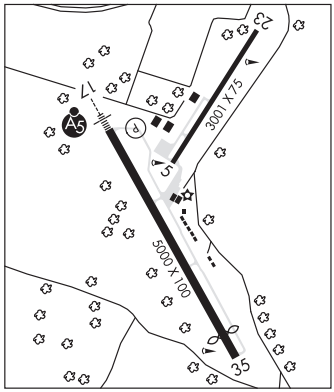

BASIN HARBOR (See VERGENNES on page 332)