

NEWPORT**NORTHEAST KINGDOM INTL** (EFK)(KEFK) 3 SW UTC-5(-4DT) N44°53.29' W72°13.72'**MONTREAL**
H-11D, L-32H
IAP

934 B LRA NOTAM FILE BTV

RWY 18-36: H5301X100 (ASPH) S-30, D-44 PCN 33 F/D/X/T MIRL**RWY 18:** REIL. PAPI(P4L)—GA 3.0° TCH 43'. Thld dspcd 299'.**RWY 36:** REIL. PAPI(P4L)—GA 3.0° TCH 44'. Ground.**RWY 05-23:** H3996X100 (ASPH) S-30, D-44**RWY 05:** Trees.**RWY 23:** Pole.**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** ACTVT PAPI Rwy 18 and 36;
MIRL Rwy 18-36—CTAF.**AIRPORT REMARKS:** Attended 1400-2200Z. 100LL and Jet A+ fuel 24 hr self svv. Mobile fuel vehicle when atndd. Rwy conds not mnt when unatdd. Rwy 05 extsv cracking, shoulders failed. Gulls on and in vicinity of arpt. Cold temperature airport. Altitude correction required at or below -32C.**AIRPORT MANAGER:** 802-272-7725**WEATHER DATA SOURCES:** AWOS-3P 118.275 (802) 334-4427.**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **BOSTON CENTER APP/DEP CON** 135.7**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BML.**BERLIN (DH) DME** 116.55 BML Chan 112(Y) N44°38.01'

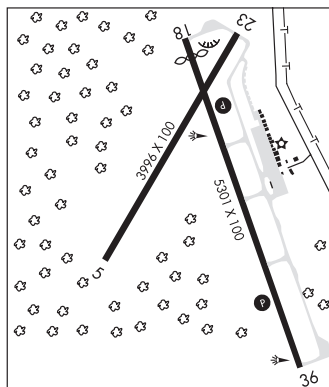
W71°11.17' 289° 47.1 NM to fld. 1730.

DME unusable:

080°-125° blo 10,000'

188°-198° blo 10,000'

275°-292° blo 10,000'

**NORTHEAST KINGDOM INTL** (See NEWPORT on page 330)**PATRICK LEAHY BURLINGTON INTL** (See BURLINGTON on page 325)**POST MILLS** (2B9) 0 E UTC-5(-4DT) N43°53.02' W72°15.13'**NEW YORK**

696 NOTAM FILE BTV

RWY 04-22: 2900X80 (TURF)**RWY 04:** Trees. Rgt tfc.**RWY 22:** Road.**RWY 05-23:** 2300X80 (TURF) 0.8% up NE**RWY 05:** Trees. Rgt tfc.**RWY 23:** Road.**AIRPORT REMARKS:** Attended irregularly. Ultralights; gliders and hot air balloons on and invof arpt. Arpt open to ski acft only when snow covered. No snow removal. See snowtam rpts. Propane avbl for hot air balloons.**AIRPORT MANAGER:** 802-266-1355**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-6859.