
SPRINGFIELD

HARTNESS STATE (SPRINGFIELD) (VSF)(KVSF) 3 NW UTC–5(–4DT) N43°20.62′ W72°31.04′ **NEW YORK**
578 B TPA—See Remarks NOTAM FILE VSF **H–11D, 12K, L–32G**
RWY 05–23: H5501X100 (ASPH) S–32, D–45 MIRL 0.3% up SW **IAP**
RWY 05: REIL. VASI(V4L)—GA 4.0° TCH 59′. Trees.
RWY 23: Trees.
RWY 11–29: H3000X75 (ASPH) S–30 MIRL 0.3% up W
RWY 11: Trees.
SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT REIL Rwy 05; MIRL Rwy 05–23 and 11–29—CTAF.
NOISE: Noise sensitive area W of arpt.
AIRPORT REMARKS: Attended 1200–2300Z‡. Aft hrs svc call 603–762–8080. Call–in fee. Birds on and invof arpt. Gliders on and invof arpt. A+ fuel full svc only. 100LL fuel full and self svc. Rwy conds not mnt when unatndd. Rwy 23 calm wind rwy. TPA—1658(1100) single engine, 2158(1600) multi–engine. Maintain TPA on downwind leg for Rwy 05. Apn and Twys A and B are PCN S–46 and D–62. 15 ft drop–off, 100 ft fm Rwy end 15 & 23. 30 ft drop–off, 250 ft fm Rwy end 11 & 290 ft fm Rwy end 29. Cold temperature airport. Altitude correction required at or below –19C.
AIRPORT MANAGER: 802-272-7725
WEATHER DATA SOURCES: ASOS 121.425 (802) 886–6006.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **BOSTON CENTER APP/DEP CON** 134.7
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.
RADIO AIDS TO NAVIGATION: NOTAM FILE LEB.
LEBANON (L) DME 113.7 LEB Chan 84 N43°40.73′ W72°12.96′ 213° 24.0 NM to fld. 1443.
DME unusable:
045°–075° byd 36 NM blo 10,000′
091°–119° byd 30 NM blo 7,500′
161°–304° byd 30 NM blo 6,300′
LOC/DME 111.3 I–VSF Chan 50 Rwy 05. LOC/DME unmonitored. DME unusable byd 11 NM blw 3,500′; byd 20° r of course.

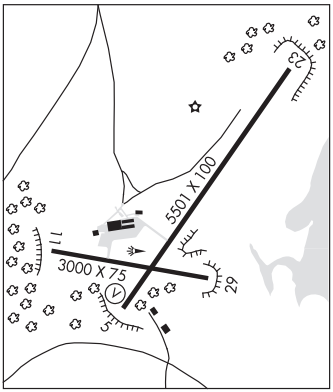

VERGENNES

BASIN HARBOR (BØ6) 4 NW UTC–5(–4DT) N44°11.50′ W73°21.52′ **MONTREAL**
124 NOTAM FILE BTV
RWY 02–20: 3000X90 (TURF)
RWY 02: Trees.
RWY 20: Trees.
AIRPORT REMARKS: Unatndd. Rwy 02–20 clsd from Nov 15–Apr 15. Birds on and invof arpt. Rwy sfc soft aft hvy rain. 60 ft trees, 70 ft each side of rwy cntrln, S 2000 ft. Rwy 02 thr not mkd. Rwy 20 thr mkd with 3 ft diam yellow cones, 2 on each side.
AIRPORT MANAGER: 802-475-2311
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Burlington Apch at 802-657-4413, when Apch clsd ctc Boston ARTCC at 603-879-6859.

WARREN–SUGARBUSH (ØB7) 2 E UTC–5(–4DT) N44°07.04′ W72°49.62′ **MONTREAL**
1470 NOTAM FILE BTV
RWY 04–22: H2575X30 (ASPH) S–8.5 0.5% up SW
RWY 04: Trees. Rgt tfc.
RWY 22: Trees.
SERVICE: **FUEL** 100LL
AIRPORT REMARKS: Attended May–Oct 1400–2300Z‡. Arpt CLOSED Nov–Apr. 100LL fuel self svc only durg atndd hrs. Extensive glider activity on arpt sfc to 18000 ft dalgt hrs. No line of sight between rwy ends. TGLS NA. Grass areas not authorized for taxi, takeoffs and ldgs without first checking UNICOM or management for field conds.
AIRPORT MANAGER: 802-496-2290
COMMUNICATIONS: CTAF/UNICOM 123.0
CLEARANCE DELIVERY PHONE: For CD ctc Burlington Apch at 802-657-4413, when Apch clsd ctc Boston ARTCC at 603-879-6859.