WEST DOVER

DEERFIELD VALLEY RGNL (4V8) 1 SW UTC–5(–4DT) N42°55.63´ W72°51.94´ **NEW YORK**
L–32G, 33C

1953 NOTAM FILE BTV

RWY 01–19: H2650X75 (ASPH) MIRL

RWY 01: Trees.

RWY 19: Trees.

AIRPORT REMARKS: Unattended. Arpt clsd indefly. Rwy 01–19 extsv cracking. No ln of sight btw rwy ends. 60 ft drop off, 60 ft fm Rwy end 19. No windsock. Ldg fee.

AIRPORT MANAGER: 281-788-8450

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **BOSTON CENTER APP/DEP CON** 123.75


CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

CAMBRIDGE (VL) (L) VORW/DME 115.0 CAM Chan 97 N42°59.66´ W73°20.64´ 115° 21.5 NM to fld. 1490/14W.

DME unusable:
040°–130° blo 9,000´

VOR unusable:
011°–021° byd 42 NM
022°–127° byd 40 NM
128°–144°
145°–160° byd 40 NM
161°–182°
183°–194° byd 40 NM
195°–205°
320°–010° byd 40 NM

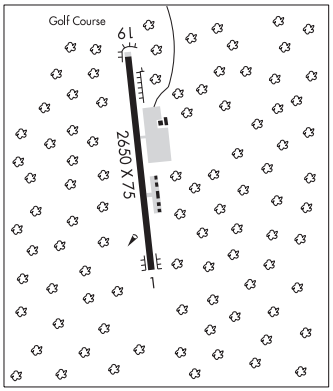

WILLIAM H MORSE STATE (See BENNINGTON on page 324)