
RICHMOND/ASHLAND

HANOVER CO MUNI (OFP)(KOFP) 8 N UTC–5(–4DT) N37°42.54′ W77°26.20′ **WASHINGTON**
207 B TPA—1007(800) NOTAM FILE OFP **H–10H, 12I, L–34E, 36H**
RWY 16–34: H5402X100 (ASPH–GRVD) S–54, D–70, **IAP**
2D–119 PCR 210 F/D/X/T HIRL
RWY 16: REIL. PAPI(P4L)—GA 3.0° TCH 40′. Tree.
RWY 34: REIL. PAPI(P4L)—GA 3.0° TCH 50′. Trees.
SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2, 3, 4 **LGT** ACTVT REIL Rwys 16 & 34; PAPI Rwy 16 and 34; HIRL Rwy 16–34—CTAF.
NOISE: Noise sensitive area S of arpt.
AIRPORT REMARKS: Attended 1200–0000Z‡. Deer and birds on and invof arpt. For arpt svcs call 804–798–6500. Acft on apch to KRIC Rwy 16 xng ovr arpt. Rwy 34 preferred rwy with wind less than 5 kts.
AIRPORT MANAGER: 804-365-6208
WEATHER DATA SOURCES: ASOS 119.025 (804) 752–2902.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **POTOMAC APP/DEP CON** 126.4 (001°–185°) 126.75 (186°–360°) 118.2
CLNC DEL 125.4
CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-640-4124.
RADIO AIDS TO NAVIGATION: NOTAM FILE RIC.
RICHMOND (H) (H) VORTACW 114.1 RIC Chan 88 N37°30.14′ W77°19.22′ 345° 13.6 NM to fld. 158/9W.
TACAN AZIMUTH unusable:
060°–075° byd 10 NM blo 1,700′
340°–350° byd 9 NM
VOR unusable:
013°–023° byd 9 NM blo 2,000′
LOC/DME 109.7 I–OFP Chan 34 Rwy 16. LOC unmonitored when arpt unatndd.

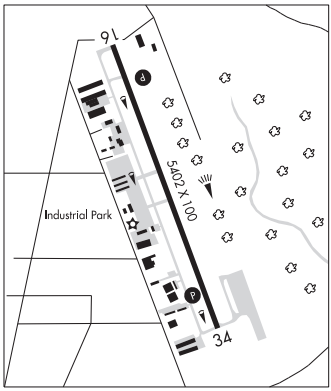

RICHMOND N37°30.14′ W77°19.22′ NOTAM FILE RIC. **WASHINGTON**
(H) (H) VORTACW 114.1 RIC Chan 88 at Richmond Intl. 158/9W. **H–10H, 12H, L–34E, 36H**
TACAN AZIMUTH unusable:
060°–075° byd 10 NM blo 1,700′
340°–350° byd 9 NM
VOR unusable:
013°–023° byd 9 NM blo 2,000′
RCO 122.4 (LEESBURG RADIO)