ELKINS/RANDOLPH CO (JENNINGS RANDOLPH FLD) (EKN)(KEKN) 2 S UTC–5(–4DT) N38°53.37′ W79°51.43′ **CINCINNATI L–29C IAP**

1987 B TPA—3000(1013) NOTAM FILE EKN

RWY 14–32: H4544X140 (ASPH) S–10 1.0% up NW

RWY 14: Tree.

RWY 32: Thld dsplcd 1390′. Trees.

RWY 05–23: H4501X75 (ASPH) S–28, D–35, 2D–56 MIRL 0.6% up SW

RWY 05: Thld dsplcd 154′. Trees.

RWY 23: REIL. PAPI(P2L)—GA 5.0° TCH 45′. Antenna.

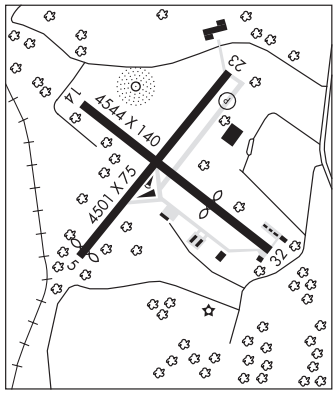

SERVICE: **FUEL** 100LL, JET A **LGT** Actvt MIRL Rwy 05–23 & REIL Rwy 23—122.9. Rwy 23 omni–directional REIL. PAPI Rwy 23 non–std 5 deg glide angle.

AIRPORT REMARKS: Attended 1330–2200Z‡. Rwy 14–32 CLOSED dusk–dawn. Deer on and invof arpt. Uncontrolled vehicles Rwy 32 crossing thr. For aftr hrs serv call amgr during bus hrs. All fueling 24 hr self service. Rwy 32, 100 ft AGL twr, 500 ft SW. Tower 100ft AGL 500 ft SW Rwy 32. Rwy 05–23 & Rwy 14–32 2–12 inch deep drainage structures on paved shoulders. Rwy 32 156 ft trees, 110 fm Rwy end 220 L. Cold temperature airport. Altitude correction required at or below –20C. Rwy 23, 68 ft athletic fld lgts, 550 ft south of rwy centerline.

AIRPORT MANAGER: 304-636-2726

WEATHER DATA SOURCES: ASOS 119.275 (304) 636–5603.

COMMUNICATIONS: CTAF 123.6

Ⓡ **CLARKSBURG APP/DEP CON** 121.15 (1200–0400Z‡)

Ⓡ **WASHINGTON CENTER APP/DEP CON** 128.6 (0400–1200Z‡)

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Washington ARTCC at 703-771-3587.

AIRSPACE: CLASS E svc 1200–0400Z‡; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE EKN.

(L) (L) VORTACW 114.2 EKN Chan 89 N38°54.87′ W80°05.96′ 104° 11.4 NM to fld. 2160/7W.

TACAN AZIMUTH & DME unusable:

081°–189° byd 32 NM blo 9,000′

273°–039° byd 12 NM blo 6,000′

RANDOLPH COUNTY NDB (HW) 284 RQY N38°53.64′ W79°51.56′ at fld. 1938/7W.

NDB unusable:

018°–084° byd 10 NM

085°–017° byd 15 NM

LDA/DME 109.9 I–OUW Chan 36 Rwy 00X. LDA is circling apch only. LOC unusable byd 6.0 NM blw 4,500′. DME portion unusable byd 6.0 NM blw 4,500′.

ELKINS N38°54.87′ W80°05.96′ NOTAM FILE EKN. **CINCINNATI H–10H, 12H, L–29C**

(L) (L) VORTACW 114.2 EKN Chan 89 104° 11.4 NM to Elkins/Randolph Co (Jennings Randolph Fld). 2160/7W.

TACAN AZIMUTH & DME unusable:

081°–189° byd 32 NM blo 9,000′

273°–039° byd 12 NM blo 6,000′

FAIRMONT MUNI–FRANKMAN FLD (4G7) 2 SW UTC–5(–4DT) N39°26.85′ W80°10.06′ **CINCINNATI L–29C IAP**

1032 B NOTAM FILE EKN

RWY 05–23: H2965X75 (ASPH) S–12.5 MIRL 0.7% up SW

RWY 05: Thld dsplcd 720′. Ground.

RWY 23: REIL. Trees.

SERVICE: S4 **FUEL** 100LL **LGT** Rwy 05–23 MIRL opr continuously dusk to 0500Z‡. After 0500Z‡, ACTIVATE REIL Rwy 23; MIRL Rwy 05–23—CTAF.

AIRPORT REMARKS: Attended Apr–Oct 1300Z‡–dusk, Nov–Mar 1400–2200Z‡. Deer on and in vicinity of arpt. Radio twrs approximately 300′ AGL 1.9 NM NE and 2.2 NM NW. Rwy 05 has +30′ hill at SW end. Rwy 23 has 100′ drop off, NE end.

AIRPORT MANAGER: 304-366-1300

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **CLARKSBURG APP/DEP CON** 121.15 (1200–0400Z‡)

Ⓡ **CLEVELAND CENTER APP/DEP CON** 126.95 (0400–1200Z‡) or ctc Cleveland ARTCC at 440–774–0226.

CLNC DEL 118.35

CLEARANCE DELIVERY PHONE: For CD ctc Clarksburg Apch at 304-842-2011, when Apch clsd ctc Cleveland ARTCC at 440-774-0226.

RADIO AIDS TO NAVIGATION: NOTAM FILE MGW.

MORGANTOWN (L) (L) VOR/DME 111.6 MGW Chan 53 N39°33.40′ W79°51.62′ 250° 15.7 NM to fld. 2343/5W.