BAR HARBOR

HANCOCK CO/BAR HARBOR (BHB)(KBHB) 8 NW UTC–5(–4DT) N44°26.98′ W68°21.69′ **HALIFAX H–11D, L–32I IAP**

83 B Class IV, ARFF Index A NOTAM FILE BHB

RWY 04–22: H5200X100 (ASPH) D–72, 2S–91, 2D–100 PCR 350 F/D/X/T HIRL

RWY 04: REIL. VASI(V4L)—GA 3.0° TCH 55′. Trees.

RWY 22: MALSF. VASI(V4L)—GA 3.0° TCH 55′.

RWY 17–35: H3363X75 (ASPH) S–13, D–20 PCR 40 F/D/Y/U 1.1% up N No Part 121/Part 380 Ops

RWY 17: Thld dsplcd 684′. Tree.

RWY 35: Thld dsplcd 111′.

RUNWAY DECLARED DISTANCE INFORMATION


RWY 04: TORA–5200 TODA–5200 ASDA–5200 LDA–5200

RWY 22: TORA–5200 TODA–5200 ASDA–5200 LDA–5200

SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTVT MALSF Rwy 22, REIL Rwy 04, VASI Rwy 04 and 22, HIRL Rwy 04–22—122.7.

NOISE: Durg VFR conds when wind speed less than 5 kts as rprtd by AWOS or UNICOM, all acft using Rwy 04–22 are reqd to tkof and land on Rwy 22 for noise abatement procs.

AIRPORT REMARKS: Attended 1300–2300Z‡. Birds on and invof arpt. Grass areas unavbl for acft ops. Seaplane ramp unavbl for acft ops exc PPR 207–667–7329. FICON not mnt Mon–Fri 0200–1230Z‡, wkends & hols. Rwy 04–22 due to hump at midpoint, opposite ends of rwy not visible at gnd level. 48 hr PPR for unsked ACR ops at least 31 pax seats. Ctc amgr. PPR for overweight ldgs. PPR for unsked ACR ops rqrg 14 CFR 139 ARFF. Ctc amgr. Twy B clsd to all acft greater than 10,000 lbs. Twys F and Twy G clsd Dec 1–Mar 31 annually. Lndg fee.

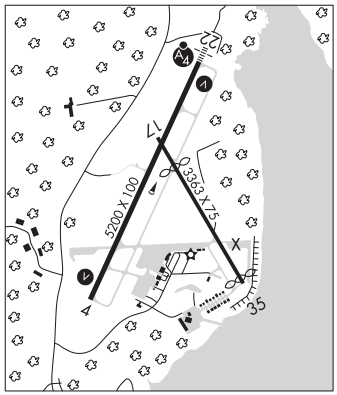

AIRPORT MANAGER: 207-667-7329

WEATHER DATA SOURCES: AWOS–3PT 118.35 (207) 667–7364.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ **BANGOR APP/DEP CON** 133.6

CLNC DEL 119.9

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.

BANGOR (VH) (DH) VORTACW 114.8 BGR Chan 95 N44°50.51′ W68°52.44′ 156° 32.2 NM to fld. 360/19W.

ILS/DME 108.3 I–BHB Chan 20 Rwy 22. Class IB.

COMM/NAV/WEATHER REMARKS: If CD freq unavbl ctc Bangor Apch at 207–561–2500 extn 1.

BELFAST MUNI (BST)(KBST) 1 SW UTC–5(–4DT) N44°24.56′ W69°00.71′ **MONTREAL L–32I IAP**

198 B NOTAM FILE BGR

RWY 15–33: H4000X100 (ASPH) S–30 MIRL 1.0% up NW

RWY 15: REIL.

RWY 33: REIL. Trees.

SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT REIL Rwy 15 and 33; MIRL Rwy 15–33—CTAF.

AIRPORT REMARKS: Attended irregularly. Deer and birds on and invof arpt. Sfc cond rprtd daily 1400–2200Z‡ Dec–Mar. 800 ft x 30 ft parl turf ldg area E of rwy and N of Twy B. Call 603–970–1947 for wint avbl. Lndg fee waived with fuel purchase.

AIRPORT MANAGER: 603-970-1947

WEATHER DATA SOURCES: AWOS–AV 122.975 (207) 930–7071. (WX CAM)

COMMUNICATIONS: CTAF/UNICOM 122.975

Ⓡ **BANGOR APP/DEP CON** 118.925

CLEARANCE DELIVERY PHONE: For CD ctc Bangor Apch at 207-561-2500 extn 1.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.

BANGOR (VH) (DH) VORTACW 114.8 BGR Chan 95 N44°50.51′ W68°52.44′ 212° 26.6 NM to fld. 360/19W.

COMM/NAV/WEATHER REMARKS: AWOS avbl — CTAF–2 clicks or call (207)–930–7071.

