COLLEGE PARK (CGS)(KCGS) 1 SE UTC–5(–4DT) N38°58.83′ W76°55.33′ **WASHINGTON**
COPTER
L–29E, 34F, 36I, A
IAP

49 B NOTAM FILE CGS

RWY 15–33: H2980X60 (ASPH) MIRL 0.3% up NW

RWY 15: REIL. PAPI(P2L)—GA 4.0° TCH 27′. Thld dsplcd 564′. Trees.

RWY 33: REIL. PAPI(P2R)—GA 4.0° TCH 27′. Thld dsplcd 171′. Trees.

RUNWAY DECLARED DISTANCE INFORMATION


RWY 15: TORA–2980 TODA–2980 ASDA–2740 LDA–2176

RWY 33: TORA–2980 TODA–2980 ASDA–2846 LDA–2675

SERVICE: **FUEL** 100LL, JET A1+ **LGT** ACTVT REIL Rwy 15 and 33; PAPI Rwy 15 and 33; MIRL Rwy 15–33—CTAF.

NOISE: NS ABTMT procedures in effect ctc arpt mgr 301–864–5844.

AIRPORT REMARKS: Attended 1200–0300Z‡. Deer and other wildlife on and invof arpt. Compliance with 14 CFR Section 93.335 is rqr before pilots may opr to/from this arpt. AER 15 heavy smoke and firefighting training ops intermittently in progress. No student touch and go ldg or solo ops permitted. No acft over 12,500 lbs manufacturer GWT, helicopters only with 24 hr PPR, call arpt mgr 301–864–5844. No tkfs 0300–1200Z‡, ldg only. Bldg 0.1 NM S of arpt 23′ AGL lgtd. Transient parking: first 4 hrs free; fee aft, waived w/min fuel purchase; overnight fee. Hel ramp fee; waived if under 3500 lbs or min fuel purchase. Acft handling fee if relocation to/from fuel area rqrd by arpt pers.

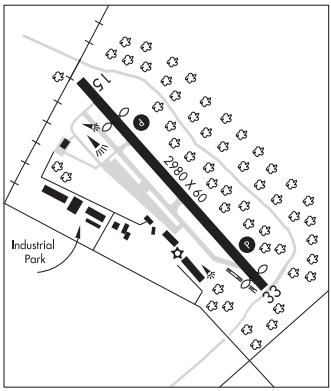

AIRPORT MANAGER: 301-864-5844

WEATHER DATA SOURCES: AWOS–3 121.225 (301) 864–5497.

COMMUNICATIONS: CTAF/UNICOM 122.975

Ⓡ **POTOMAC APP/DEP CON** 125.65 124.7

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-599-3874.

RADIO AIDS TO NAVIGATION: NOTAM FILE BWI.

BALTIMORE (L) (L) VORTACW 115.1 BAL Chan 98 N39°10.26′ W76°39.68′ 238° 16.7 NM to fld. 150/11W.

DME unusable:
133°–155° byd 20 NM blo 10,000′
133°–155° byd 36 NM
300°–349° byd 35 NM

VOR unusable:
133°–155° byd 20 NM blo 10,000′
197°–217° byd 17 NM
260°–281° byd 15 NM
282°–292°

TACAN AZIMUTH unusable:
029°–042° byd 30 NM
133°–155° byd 20 NM blo 10,000′
180°–190° byd 17 NM
300°–349° byd 35 NM

CRISFIELD–SOMERSET CO (W41) 3 NE UTC–5(–4DT) N38°01.09′ W75°49.61′ **WASHINGTON**
L–34F, 36I
IAP

4 B NOTAM FILE DCA

RWY 14–32: H2397X75 (ASPH) S–12 MIRL

RWY 14: REIL. PAPI(P2L)—GA 3.0° TCH 39′.

RWY 32: REIL. PAPI(P2L)—GA 3.25° TCH 33′. Road.

RWY 06–24: 1060X120 (TURF)

RWY 06: Trees.

RWY 24: Trees.

SERVICE: **FUEL** 100LL **LGT** ACTVT REIL Rwy 14 & 32; MIRL Rwy 14–32—CTAF.

AIRPORT REMARKS: Attended 1330–2130Z‡. Rwy 06–24 clsd indefly. Birds and wildlife on and invof arpt. Turf areas of arpt may be soft. Rwy 32 marking faded, missing.

AIRPORT MANAGER: 410-968-1333

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **PATUXENT APP/DEP CON** 127.95 (1200–0400Z‡ Mon–Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.