
LAUREL MUNI (6S8) 2 N UTC–7(–6DT) N45°42.31′ W108°45.65′ **BILLINGS**
3543 B NOTAM FILE GTF **H–1E, L–13D**
RWY 04–22: H5199X75 (ASPH) S–12.5 MIRL 0.6% up SW **IAP**
RWY 04: PAPI(P2L)—GA 3.0° TCH 34′.
RWY 22: PAPI(P2L)—GA 3.0° TCH 41′.
RWY 14–32: H3002X60 (ASPH) S–12.5 MIRL 2.0% up NW
RWY 14: PAPI(P2L)—GA 4.0° TCH 21′.
RWY 32: PAPI(P2L)—GA 3.0° TCH 21′.
RWY 09–27: 1100X60 (TURF) 2.2% up W
SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTVT PAPI RWY 04 & 22 & 14 & 32; MIRL RWY 04–22 & RWY 14–32—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1500–0000Z‡, Sat–Sun intermittently. Parachute Jumping. Ultralights on and invof arpt. Numerous deer and antelope on and invof rwy. Intermittent snow removal, be alert during winter months. Rwy 09–27 not maintained during winter. Rwy 09–27 marker cones full rwy length.
AIRPORT MANAGER: 406-628-0172
WEATHER DATA SOURCES: AWOS–3 135.05 (406) 628–9867.
COMMUNICATIONS: CTAF/AUNICOM 123.05
Ⓡ **BILLINGS APP/DEP CON** 119.2 120.5
CLEARANCE DELIVERY PHONE: For CD ctc Billings Apch at 406-255-2798
RADIO AIDS TO NAVIGATION: NOTAM FILE BIL.
BILLINGS (VH) (H) VORTACW 114.5 BIL Chan 92 N45°48.51′ W108°37.48′ 209° 8.4 NM to fld. 3811/14E.
VOR unusable:
146°–154° byd 40 NM
155°–165° byd 40 NM blo 11,000′
155°–165° byd 49 NM blo 18,000′
166°–173° byd 40 NM

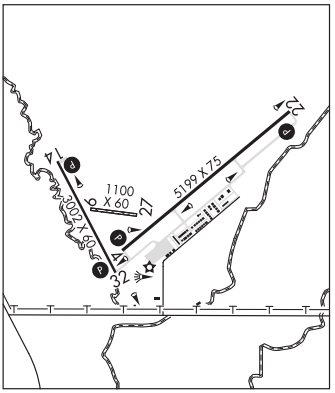

LAVINA (8ØS) 2 NW UTC–7(–6DT) N46°18.44′ W108°57.29′ **BILLINGS**
3512 NOTAM FILE GTF
RWY 07–25: 3460X100 (TURF) 0.7% up W
AIRPORT REMARKS: Unattended. No snow removal. Rwy 07–25 very muddy when wet; few gopher holes. Rwy 07–25 marked with cones full rwy length. Cell twr 0.5 mi ESE of arpt.
AIRPORT MANAGER: 406-444-2506
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Billings Apch at 406-255-2798

LEFT COULEE (See WINIFRED on page 152)