
ROUNDUP (RPX)(KRPX) 2 N UTC–7(–6DT) N46°28.50′ W108°32.61′ **BILLINGS**
3490 B NOTAM FILE GTF **H–1E, L–13D**
RWY 07–25: H5099X75 (ASPH) S–12.5 MIRL 0.7% up W **IAP**
RWY 07: PAPI(P2L)—GA 4.0° TCH 43′. Ground.
RWY 25: PAPI(P2L)—GA 3.0° TCH 42′.
RWY 16–34: 2460X100 (TURF) 0.8% up S
SERVICE: S4 **FUEL** 100LL, JET A1 **LGT** ACTIVATE MIRL Rwy 07–25; PAPI Rwy 07 and Rwy 25—122.7.
AIRPORT REMARKS: Unattended. Parachute Jumping. Credit card self svc fuel avbl 24 hrs. Wildlife on and invof arpt. Ultralights on and invof arpt. Rgt tfc Rwy 25 from 0500–1400Z‡. Rwy 16–34 marked with white cones full length, red cones mark thld.
AIRPORT MANAGER: 406-323-1564
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ**SALT LAKE CENTER APP/DEP CON** 126.85
CLEARANCE DELIVERY PHONE: For CD ctc Billings Apch at 406-255-2798.
RADIO AIDS TO NAVIGATION: NOTAM FILE BIL.
BILLINGS (VH) (H) VORTACW 114.5 BIL Chan 92 N45°48.51′ W108°37.48′ 351° 40.1 NM to fld. 3811/14E.
VOR unusable:
146°–154° byd 40 NM
155°–165° byd 40 NM blo 11,000′
155°–165° byd 49 NM blo 18,000′
166°–173° byd 40 NM

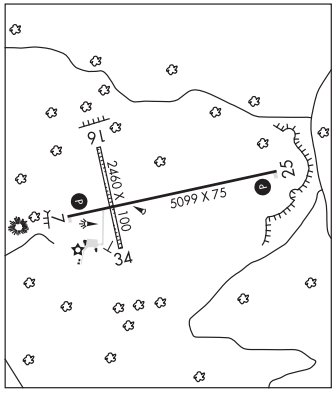

RUBY VALLEY FLD (See TWIN BRIDGES on page 148)

RUSSIAN FLAT (M42) 0 N UTC–7(–6DT) N46°43.46′ W110°25.07′ **GREAT FALLS**
6336 NOTAM FILE GTF
RWY 07–25: 3000X65 (TURF)
RWY 07: Trees.
RWY 25: REIL. Hill.
AIRPORT REMARKS: Unattended. Wildlife & livestock possible on ry. Rwy 07–25 thld and 1/4 distances mkd with white turf rwy cones. Recommended tkf Rwy 07, ldg Rwy 25. Uphill slope to west. Standing wtr, muddy conds aft hvy rains.
AIRPORT MANAGER: 406-566-4003
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

RYEGATE (8UØ) 1 S UTC–7(–6DT) N46°17.43′ W109°14.86′ **GREAT FALLS**
3689 NOTAM FILE GTF
RWY 07–25: 3440X100 (TURF)
AIRPORT REMARKS: Unattended. No snow removal. Rwy 07–25 sfc cond rough, gopher holes. Rwy 07–25 marked by white cones full len. 300+ ft hill 0.75 mi SE fm end of rwy.
AIRPORT MANAGER: 406-444-2506
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

ST IGNATIUS (52S) 1 NE UTC–7(–6DT) N47°19.50′ W114°04.85′ **GREAT FALLS**
3006 B NOTAM FILE GTF
RWY 08–26: H2610X60 (ASPH) LIRL 1.4% up E
RWY 08: Road.
RWY 26: Road.
SERVICE: S2 **FUEL** 100LL **LGT** ACTVT LIRL Rwy 08–26—CTAF.
AIRPORT REMARKS: Attended continuously. Birds invof rwy. Snow removal. Rwy 08–26 100 ft unlgtd; 2270 ft lgtd at ngt. Rwy 26 240 ft unlgtd. Rwy 26 18 ft bldg 200 ft fm rwy end 234 ft R of cntrln; 18 ft bldg 385 fm rwy end 141 ft L of cntrln. Turf ovrn 300 x 60 ft. Rwy 08 markings non std.
AIRPORT MANAGER: (406) 544-8004
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Spokane Apch at 509-742-2522, when Apch clsd ctc Salt Lake ARTCC at 801-320-2568

ST LABRE MISSION (See ASHLAND on page 92)